

Single Survey

survey report on:

| | |
|-------------------------|--------------------------------------------------------------------------|
| Property address | Flat 29, 11 Oxgangs Road North, Oxgangs, EDINBURGH, EH13 9AA |
|-------------------------|--------------------------------------------------------------------------|

| | |
|-----------------|---------------------------|
| Customer | Elizabeth Ewing Macdonald |
|-----------------|---------------------------|

| | |
|-------------------------|-------------------------------------------------------------------|
| Customer address | c/o MacRoberts LLP, 10 George Street, Edinburgh, EH2 2PF |
|-------------------------|-------------------------------------------------------------------|

| | |
|--------------------|-------------------------------|
| Prepared by | ALLIED SURVEYORS SCOTLAND PLC |
|--------------------|-------------------------------|

| | |
|---------------------------|------------------|
| Date of inspection | 4th October 2022 |
|---------------------------|------------------|



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

| | |
|--------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Description | Second (top) floor flat in purpose built three storey detached block of 28 retirement flats. |
| Accommodation | Hallway with tank/meter store off, Living/Dining Room with Kitchen off, Double Bedroom with fitted wardrobe, Shower Room. |
| Gross internal floor area (m²) | 52m ² approx. |
| Neighbourhood and location | <p>The property is located in an established mixed mainly residential neighbourhood in the south west suburbs.</p> <p>The development is positioned a short distance to the south of the roundabout between Colinton Road and Oxfangs Road North. Firrhill School is nearby to the east and there is also a water works station to the east. It is believed there was a petrol filling station on the site prior to the present development.</p> <p>Across the street to the west is the site of Redford Barracks. It is believed the barracks are to be vacated at some stage within the next 5-10 years and, thereafter, the site is likely to be redeveloped.</p> <p>There is a Tesco Superstore a quarter mile or so to the south.</p> <p>Colinton Village provides further shopping and other such facilities half a mile or so to the west.</p> <p>The city centre is within reasonable reach by private or public transport.</p> |
| Age | The property was built by McCarthy & Stone around 2010. |
| Weather | It was dry and overcast around the time of visit. |

| | |
|-------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Chimney stacks | <p>Visually inspected with the aid of binoculars where appropriate.</p> <p>There are original stone built chimneys, though these would all appear to be dummies.</p> |
| Roofing including roof space | <p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is of pitched and hipped style clad in original concrete tiles plus there are minor lead sheet clad sections including over the subject flat's kitchen.</p> <p>No access was gained onto the roof or into any communal roof space.</p> <p>There is some roof space immediately over the subject flat accessed through a hatch in the hallway.</p> <p>There is approximately 250-300mm fibreglass insulation quilt between and over the ceiling joists in this space.</p> <p>No access was gained to any other roof space.</p> |
| Rainwater fittings | <p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The roof drains to PVC gutters and pipes.</p> |
| Main walls | <p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are approximately 330mm thick and appear to be of traditional cavity construction, stone faced externally and plasterboard lined internally.</p> |

Single Survey

| | |
|--------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Windows, external doors and joinery | <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows to the subject flat are the original PVC framed double glazed tilt and turn style units.</p> <p>The living/dining room window has an external cast iron railing.</p> <p>The flat entrance door is the original composite panel unit.</p> <p>There are PVC eaves around the roof perimeter.</p> |
| External decorations | <p>Visually inspected.</p> <p>External joiner work is painted where appropriate.</p> |
| Conservatories / porches | <p>None.</p> |
| Communal areas | <p>Circulation areas visually inspected.</p> <p>Shared entrance, foyer and access ways.</p> <p>Within the development there are various common facilities including a communal lounge, kitchen and toilet plus a refuse room, laundrette, guest suite and the like.</p> |
| Garages and permanent outbuildings | <p>None.</p> |
| Outside areas and boundaries | <p>Visually inspected.</p> <p>There are shared landscaped garden grounds around the development including a parking area.</p> <p>There are mixed boundaries around the development.</p> |
| Ceilings | <p>Visually inspected from floor level.</p> <p>Ceilings are of plasterboard.</p> |
| Internal walls | <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal partitions are of plasterboard line stud frame.</p> |

Single Survey

| | |
|----------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Floors including sub floors | <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>Floors are appear to be of suspended concrete.</p> <p>Firmly fitted floor coverings were in place throughout the property at the time of visit and there were a few furnishings.</p> <p>No access was gained to any sub floor space.</p> <p>There is a flat below.</p> |
| Internal joinery and kitchen fittings | <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>Internal doors are the original composite panel units plus there are original timber frame single glazed double doors between the kitchen and the living/dining room.</p> <p>There are mirror door fitted wardrobes in the bedroom.</p> <p>The kitchen fittings comprise the original floor and wall mounted units including a stainless steel sink and an electric hob.</p> |
| Chimney breasts and fireplaces | None. |
| Internal decorations | <p>Visually inspected.</p> <p>The flat is decorated in paper, paint and some tiling.</p> |
| Cellars | None. |
| Electricity | <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains.</p> <p>There are two meters in the store cupboard off the hallway.</p> <p>The installation includes two consumer units with miniature circuit breakers and a residual current device.</p> <p>Where visible, the installation is in PVC sheathed cabling and</p> |

Single Survey

| | |
|-------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Electricity | serves square pin 13 amp power outlets. |
| Gas | None. |
| Water, plumbing, bathroom fittings | <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains.</p> <p>Pipework, where visible, is in copper or PVC. There is no cold water storage tank. Cold water is directly off the main.</p> <p>The shower room fittings comprise a white three piece suite - mixer shower with tray and sliding door plus there is a WC and a wash hand basin.</p> <p>The bathroom also has an alarm pull cord.</p> <p>The bathroom is also ventilated by an extractor fan. The outlet to the fan duct was not confirmed.</p> |
| Heating and hot water | <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Space heating is provided by electric heaters in the living/dining room and bedroom.</p> <p>There are electric fan heaters in the kitchen and the shower room.</p> <p>There is a Gledhill 150 litre unvented hot water unit in the store room off the hallway.</p> <p>Hot water is heated by an electric immersion heater.</p> |
| Drainage | <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Foul water and storm water are assumed to be connected to the main public sewer.</p> |
| Fire, smoke and burglar alarms | <p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a two way telecom unit with pull cord alarm in the hallway.</p> <p>There are smoke/heat detectors in the hallway, living/dining room and the kitchen.</p> <p>The new Fire and Smoke Alarm Standard came into force in February 2022. This new standard requires a smoke alarm to be installed in the room most frequently used for living purposes and</p> |

Single Survey

| | |
|--------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Fire, smoke and burglar alarms | in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner a carbon monoxide detector is also required. The purchaser should satisfy themselves in this regard. |
| Any additional limits to inspection | For flats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. The flat had firmly fitted floor coverings throughout at the time of visit and there were a few items of furniture. The building fabric was seen from ground level only. No inspection for asbestos or Japanese knotweed has been carried out. |

Sectional Diagram showing elements of a typical house



- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partition wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3 | Category 2 | Category 1 |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|------------------------------------------|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

|  Structural movement | |
|-------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | No evidence of any significant or excessive structural movement was identified. |

|  Dampness, rot and infestation | |
|------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | No evidence of such defects was noted in the readily accessible areas of the subject flat. |

|  Chimney stacks | |
|----------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | From ground level, no items of immediate concern were identified. Maintenance should be anticipated. The management company should be able to advise further. |

|  Roofing including roof space | |
|------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | From ground level, no items of immediate concern were identified. Not all of the roof over the subject flat can be seen from ground level around the building. The managing agents should be able to advise further on checking and maintenance arrangements. No more than a head and shoulders inspection of the roof space over the subject flat was possible. No items of immediate concern were identified. |

Single Survey



Rainwater fittings

| | |
|------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | No items of immediate concern identified. The gullies and roof drainage should be cleaned out and checked on an annual basis to ensure they function properly. |



Main walls

| | |
|------------------------|---------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | No items of immediate concern identified. Some early weathering was noted. Maintenance should be anticipated. |



Windows, external doors and joinery

| | |
|------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | The windows are the original units. It is likely the windows are just beyond any guarantee period. Maintenance should be anticipated. The flat entrance door and other external joinery work seem reasonable. |



External decorations

| | |
|------------------------|---------------------------------|
| Repair category | 1 |
| Notes | No items of concern identified. |



Conservatories/porches

| | |
|------------------------|-----|
| Repair category | - |
| Notes | N/A |



Communal areas

| | |
|------------------------|----------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | No items of immediate concern were identified when gaining access to and leaving the subject flat. |



Garages and permanent outbuildings

| | |
|------------------------|-----|
| Repair category | - |
| Notes | N/A |



Outside areas and boundaries

| | |
|------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | <p>The grounds seem reasonably maintained.</p> <p>The managing agents should be able to advise further on grounds and boundary maintenance.</p> |



Ceilings

| | |
|------------------------|-------------------------------------------|
| Repair category | 1 |
| Notes | No items of immediate concern identified. |



Internal walls

| | |
|------------------------|-------------------------------------------|
| Repair category | 1 |
| Notes | No items of immediate concern identified. |



Floors including sub-floors

| | |
|------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | <p>From a general walk over, no items of immediate concern were identified.</p> <p>The seller indicated that new floor coverings have recently been laid throughout the flat.</p> <p>No access was gained to any sub floor space.</p> |



Internal joinery and kitchen fittings

| | |
|------------------------|--------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | <p>No items of immediate concern identified.</p> <p>The kitchen fittings are original, though remain of reasonably modern style.</p> |



Chimney breasts and fireplaces

| | |
|------------------------|-----|
| Repair category | - |
| Notes | N/A |



Internal decorations

| | |
|------------------------|-----------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | The flat was generally well presented. It is understood the flat has been redecorated in recent times. |



Cellars

| | |
|------------------------|-----|
| Repair category | - |
| Notes | N/A |



Electricity

| | |
|------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | The trade bodies governing electrical installations currently advise that these should be tested prior to a change of occupancy and, thereafter, at least once every five years, by a competent Electrician. |



Gas

| | |
|------------------------|-----|
| Repair category | - |
| Notes | N/A |



Water, plumbing and bathroom fittings

| | |
|------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | No items of immediate concern identified. The shower room fittings are in white and of modern style. Minor wear was noted to the edge seal and splash protection finishes around the shower tray. It is emphasized such features must be vigilantly maintained to ensure water tightness. |



Heating and hot water

| | |
|------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | <p>The heater in the living/dining room is a recent replacement unit.</p> <p>None of the heating units has been tested.</p> <p>A precautionary test of each would be wise to ensure they are all in good working order.</p> <p>The hot water system has not been tested. Again, a precautionary test of the system would be wise.</p> |



Drainage

| | |
|------------------------|---------------------------------------------------------------------------------------|
| Repair category | 1 |
| Notes | <p>The system has not been tested, though no obvious surface problems were noted.</p> |

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

| | |
|---------------------------------------|---|
| Structural movement | 1 |
| Dampness, rot and infestation | 1 |
| Chimney stacks | 1 |
| Roofing including roof space | 1 |
| Rainwater fittings | 1 |
| Main walls | 1 |
| Windows, external doors and joinery | 1 |
| External decorations | 1 |
| Conservatories/porches | - |
| Communal areas | 1 |
| Garages and permanent outbuildings | - |
| Outside areas and boundaries | 1 |
| Ceilings | 1 |
| Internal walls | 1 |
| Floors including sub-floors | 1 |
| Internal joinery and kitchen fittings | 1 |
| Chimney breasts and fireplaces | - |
| Internal decorations | 1 |
| Cellars | - |
| Electricity | 1 |
| Gas | - |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water | 1 |
| Drainage | 1 |

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

| | |
|-----------------------------------------------------------------------------------------------|---------------------------------------------------------------------|
| 1. Which floor(s) is the living accommodation on? | Second |
| 2. Are there three steps or fewer to a main entrance door of the property? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 3. Is there a lift to the main entrance door of the property? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 4. Are all door openings greater than 750mm? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 5. Is there a toilet on the same level as the living room and kitchen? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 6. Is there a toilet on the same level as a bedroom? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 7. Are all rooms on the same level with no internal steps or stairs? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The original bathroom has been refitted as the present shower room including mixer shower with tray. The valuation assumes any necessary authorisations for this are available. The shower and shower drainage have not been tested.

It is understood that First Port are managing agents for the development. It would be wise to confirm details of the service provided and charge for this.

There are various common facilities within development. It would be wise to confirm details.

It is understood that spaces in the parking yard are available for a payment. It may be desirable to confirm details.

Maintenance is not treated as a repair for the purposes of the Single Survey. When a Category 1 rating is used this means that the building must continue to be maintained in the normal way.

It is recommended that where repairs, defects or maintenance items have been identified within this report that interested parties make appropriate enquiries in order to satisfy themselves of potential costs or the extent of works required prior to submitting a legal offer to purchase.

The property forms part of a development of retirement flats. It would be wise to confirm details of requirements for purchase.

Estimated reinstatement cost for insurance purposes

It is understood there is a Block Buildings Insurance Policy.

Building costs are currently increasing significantly above inflation due to material and labour shortages as well as Brexit and the Pandemic. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.

Valuation and market comments

The market value of the property described in the report is £185,000 (One Hundred and Eighty Five Thousand Pounds Sterling).

This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.

The property comprises a decent retirement flat of its type.

Signed

Security Print Code [354199 = 7011]
Electronically signed

Report author

Peter N M Drennan

Single Survey

| | |
|-----------------------|-----------------------------------------|
| Company name | ALLIED SURVEYORS SCOTLAND PLC |
| Address | 22-24 Walker Street, Edinburgh, EH3 7HR |
| Date of report | 10th October 2022 |

Mortgage Valuation Report



**ALLIED
SCOTLAND**

Chartered Surveyors

Property Address

Address Flat 29, 11 Oxgangs Road North, Oxgangs, EDINBURGH, EH13 9AA
Seller's Name Elizabeth Ewing Macdonald
Date of Inspection 4th October 2022

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?

Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

None.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating:

Full electric space heating.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

The property forms part of a development of retirement flats in an established mixed mainly residential neighbourhood in the south west suburbs. Local facilities are available within reasonable reach. It is understood there was a petrol filling station on the site prior to the present development.

Internally, the property was generally well presented.

Externally, the building fabric, as seen from ground level, seems to be in reasonable condition for its age and type.

The property forms part of a development of retirement flats.

It is understood that First Port are managing agents for the development.

There are various common facilities typical for such a retirement development.

The original bathroom has been refitted as a shower room with mixer shower and tray. The valuation assumes any necessary authorisations for this are available.

Essential Repairs

None.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property forms a suitable security for loan purposes, subject to individual lender requirements.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [354199 = 7011]
Electronically signed by:-

Surveyor's name Peter N M Drennan

Professional qualifications BSc MRICS

Company name ALLIED SURVEYORS SCOTLAND PLC

Address 22-24 Walker Street, Edinburgh, EH3 7HR

Telephone 0131 226 6518

Fax 0131 220 6445

Report date 10th October 2022

Energy Performance Certificate (EPC)

Scotland

Dwellings

FLAT 29 , 11 OXGANGS ROAD NORTH, OXGANGS, EDINBURGH, EH13 9AA

Dwelling type: Top-floor flat
Date of assessment: 04 October 2022
Date of certificate: 10 October 2022
Total floor area: 52 m²
Primary Energy Indicator: 267 kWh/m²/year


Reference number: 9170-2574-7200-2902-6325
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Room heaters, electric

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

| | | |
|----------------------------------------------------------|---------------|------------------------------------------------------|
| Estimated energy costs for your home for 3 years* | £2,019 | See your recommendations report for more information |
| Over 3 years you could save* | £420 | |

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

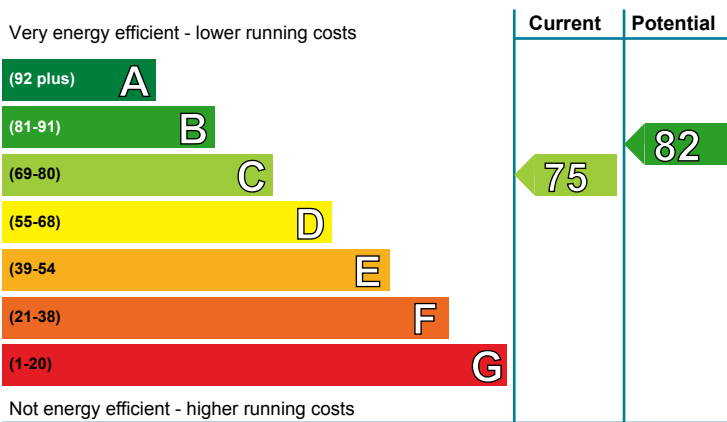


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (75)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

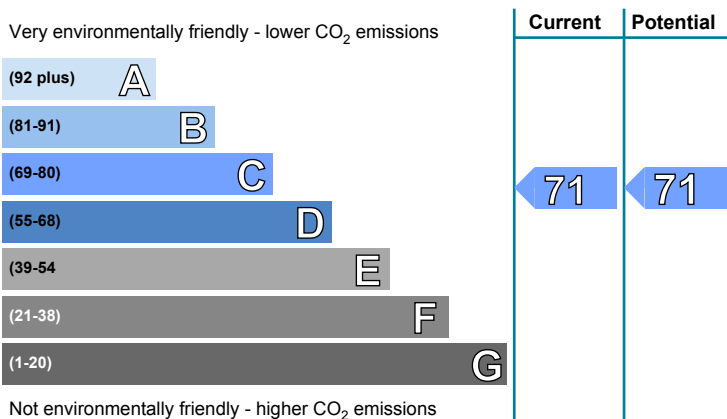

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (71)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

| Recommended measures | Indicative cost | Typical savings over 3 years |
|---------------------------------------|-----------------|------------------------------|
| 1 High heat retention storage heaters | £800 - £1,200 | £420.00 |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element | Description | Energy Efficiency | Environmental |
|-----------------------|---------------------------------------------|-------------------|---------------|
| Walls | Cavity wall, as built, insulated (assumed) | ★★★★★ | ★★★★★ |
| Roof | Pitched, 270 mm loft insulation | ★★★★☆ | ★★★★☆ |
| Floor | (another dwelling below) | — | — |
| Windows | Fully double glazed | ★★★★☆ | ★★★★☆ |
| Main heating | Room heaters, electric | ★☆☆☆☆ | ★★☆☆☆ |
| Main heating controls | Programmer and appliance thermostats | ★★★★☆ | ★★★★☆ |
| Secondary heating | None | — | — |
| Hot water | Electric immersion, off-peak | ★★☆☆☆ | ★★☆☆☆ |
| Lighting | Low energy lighting in 92% of fixed outlets | ★★★★★ | ★★★★★ |

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 45 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.4 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

| | Current energy costs | Potential energy costs | Potential future savings |
|---------------|----------------------|------------------------|-------------------------------------------------------------------------------------|
| Heating | £1,191 over 3 years | £840 over 3 years |  |
| Hot water | £663 over 3 years | £567 over 3 years | |
| Lighting | £165 over 3 years | £192 over 3 years | |
| Totals | £2,019 | £1,599 | |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures | Indicative cost | Typical saving per year | Rating after improvement | |
|---------------------------------------|-----------------|-------------------------|---------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| | | | Energy | Environment |
| 1 High heat retention storage heaters | £800 - £1,200 | £140 |  |  |

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 High heat retention storage heaters

Modern storage heaters are less expensive to run than the direct acting, on-peak heating system in the property. A dual-rate electricity supply is required to provide the off-peak electricity that these heaters use; this is easily obtained by contacting the energy supplier. Ask for a quotation for high heat retention with automatic charge and output controls. Installations should be in accordance with the national wiring standards. Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified electrical heating engineer. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 2,409 | N/A | N/A | N/A |
| Water heating (kWh per year) | 1,835 | | | |

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

| | |
|-----------------------------|------------------------------------------------------------------------------------------------------------------|
| Assessor's name: | Mr. Peter Drennan |
| Assessor membership number: | EES/009523 |
| Company name/trading name: | Allied Surveyors Scotland Plc |
| Address: | 22-24 Walker Street Edinburgh EH3 7HR |
| Phone number: | 01312266518 |
| Email address: | edinburgh.central@alliedsurveyorsscotland.com |
| Related party disclosure: | Employed by the professional dealing with the property transaction |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



PROPERTY QUESTIONNAIRE

Property address:

FLAT 29
CAIYSTANE COURT
11 OXFORDS RD NORTH
EDINBURGH
EH 13 9AA

Seller(s):

MRS E
MALCOLM

Completion date of property
questionnaire:

1/10/22

PROPERTY QUESTIONNAIRE

NOTE FOR SELLERS

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

| | |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------|
| 1. Length of ownership | |
| How long have you owned the property? | 6 YEARS |
| 2. Council Tax | |
| Which Council Tax band is your property in? (Please circle) A B C D E F G H | D |
| 3. Parking | |
| What are the arrangements for parking at your property? (Please indicate all that apply) <ul style="list-style-type: none"> • Garage • Allocated parking space ✓ • Driveway • Shared parking • On street • Resident permit • Metered parking • Other (please specify): | ✓ |
| 4. Conservation Area | |
| Is your property in a designated Conservation Area (that is an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? | Yes/No/D on't know NO |
| 5. Listed Buildings | |
| Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? | Yes/No |
| 6. Alterations / additions / extensions | |
| a. (i) During your time in the property, have you carried | Yes/No |

| | |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------|
| out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? | NO |
| If you have answered yes, please describe the changes which you have made: | N/A |
| (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? | Yes/No N/A |
| If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them. | N/A |
| b. Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below: | Yes/No |
| (i) Were the replacements the same shape and type as the ones you replaced? | Yes/No N/A |
| (ii) Did this work involve any changes to the window or door openings? | Yes/No N/A |
| (iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): | N/A |
| Please give any guarantees which you received for this work to your solicitor or estate agent. | N/A |

| | | |
|----|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| | 7. Central heating | |
| a. | <p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes/partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)</p> <p><u>If you have answered yes, please answer the three questions below:</u></p> | <p>Yes/No/ Partial</p> <p>PARTIAL</p> <p>None</p> <p>ELECTRIC HEATERS</p> <p>Lounge & BEDROOM ONLY</p> |
| | (i) When was your central heating system or partial central heating system installed? | <p>2010</p> <p>2014</p> |
| | <p>(ii) Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance agreement:</p> | <p>Yes/No</p> <p>YES</p> <p>None</p> <p>GLEDHILL</p> |
| | <p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p> | <p>None</p> <p>NOV 2021</p> |
| 8. | Energy Performance Certificate | |
| | Does your property have an Energy Performance Certificate which is less than 10 years old? | <p>Yes/No</p> |
| 9. | Issues that may have affected your property | |
| a. | Has there been any storm, flood, fire or other structural damage to your property while you have owned it? | <p>Yes/No</p> |
| | <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p> | <p>Yes/No</p> <p>N/A</p> |
| b. | Are you aware of the existence of asbestos in your property? | <p>Yes/No</p> |
| | <p><u>If you have answered yes</u>, please give details:</p> | |

| 10. Services | | | |
|------------------------------------------------------------------------------------------------------------------|-----------|----------------|-----------------------|
| a. Please tick which services are connected to your property and give details of the supplier: | | | |
| Services | Connected | Supplier | |
| Gas or liquid petroleum gas | | | |
| Water mains or private water supply | ✓ | SCOTTISH WATER | |
| Electricity | ✓ | SCOTTISH POWER | |
| Mains drainage | ✓ | | |
| Telephone | X | | |
| Cable TV or satellite | X | | |
| Broadband | X | | |
| b. Is there a septic tank system at your property? | | | Yes/No |
| If you have answered <u>yes</u> , please answer the two questions below: | | | |
| (i) Do you have appropriate consents for the discharge from your septic tank? | | | Yes/No/ Don't Know |
| (ii) Do you have a maintenance contract for your septic tank? | | | Yes/No |
| If you have answered <u>yes</u> , please give details of the company with which you have a maintenance contract: | | | |
| 11. Responsibilities for shared or common Areas | | | |

| | | |
|--------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------|
| <input type="checkbox"/> | | |
| a. | Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered <u>yes</u> , please give details: | Yes/No/ Don't Know RETIREMENT FLAT WITH COMMUNAL FACILITIES |
| b. | Is there a responsibility to contribute to repair and | Yes/No/ |

| | |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------|
| <p>maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p> | <p>Not applicable</p> <p>YES</p> <p>ANNUAL MAINTENANCE CHARGE £2000 PA</p> |
| <p>c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p> | <p>Yes/No</p> <p>NO</p> |
| <p>d. Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p> | <p>Yes/No</p> <p>COMMUNAL GROUNDS</p> |
| <p>e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p> | <p>Yes/No</p> <p>TOP FLAT</p> |
| <p>f. As far as you are aware, is there a Public Right of Way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes</u>, please give details:</p> | <p>Yes/No</p> |
| <p>12. Charges associated with your property</p> | |
| <p>a. Is there a factor or property manager for your property?</p> <p><u>If you have answered yes</u>, please provide the name and address and give details of any deposit held and approximate charges:</p> | <p>Yes/No</p> <p>LYNDSEY MIDDLETON ON SITE ON PROPERTY £2000 PA</p> |
| <p>b. Is there a common buildings insurance policy?</p> | <p>Yes/No/Don't know</p> <p>Don't know</p> |
| <p><u>If you have answered yes</u>, is the cost of the insurance included in your monthly/annual factor's charges?</p> | <p>Yes/No/Don't know</p> <p>Don't know</p> |
| <p>c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common</p> | |

| | |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------|
| <p>areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> | <p>GENERAL MAINTENANCE OF FACILITIES WITHIN PROPERTY i.e. WASHING MACHINES</p> |
| <p>13. Specialist Works</p> | |
| <p>a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property</p> | <p>Yes/No</p> |
| <p>b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details</p> | <p>Yes/No</p> |
| <p>c. <u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p> | <p>Yes/No</p> |
| <p>14. Guarantees</p> | |
| <p>a. Are there any guarantees or warranties for any of the following:</p> | |
| <p>(i) Electrical work</p> | <p>No Yes Don't Know</p> |
| <p>With title deeds</p> | <p>Lost</p> |

| | | | | | |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|----------------|-----------------------|-----------------------------|-------------------------------------|
| (ii) Roofing | No | Yes | Don't Know | With title deeds | Lost |
| (iii) Central heating | No | Yes | Don't know | With title deeds | Lost |
| (iv) National House Building Council (NHBC) | No | Yes | Don't know | With title deeds | Lost |
| (v) Damp course | No | Yes | Don't know | With title deeds | Lost |
| (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) | No | Yes | Don't know | With title deeds | Lost |
| <p>b. <u>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</u></p> | | | | | |
| <p>c. Are there any outstanding claims under any of the guarantees listed above?</p> <p><u>If you have answered yes, please give details:</u></p> | | | | | <p>Yes/No</p> |
| <p>15. Boundaries</p> | | | | | |
| <p>So far as you are aware, has any boundary of your property been moved in the last 10 years?</p> <p><u>If you have answered yes, please give details:</u></p> | | | | | <p>Yes/No/Don't know</p> |
| <p>16. Notices that affect your property</p> | | | | | |
| <p>In the past three years have you ever received a notice:</p> | | | | | |
| <p>a. advising that the owner of a neighbouring property has made a planning application?</p> | | | | | <p>Yes/No/Don't know</p> |
| <p>b. that affects your property in some other way?</p> | | | | | <p>Yes/No/Don't know</p> |

| | |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------|
| c. that requires you to do any maintenance, repairs or improvements to your property? | Yes/No/ Don't know |
| If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property. | |

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :

..... M E Macdonald (POWER OF ATTORNEY)

..... Ely & Macdonald (OWNER)

Date: 1/10/22