YOUR ONESURVEY HOME REPORT

ADDRESS

Flat 2/2 1322 London Road Glasgow G31 4LD

PREPARED FOR

Stuart Glen

INSPECTION CARRIED OUT BY:

Walker Fraser Steele

SELLING AGENT:



HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
Single Survey	Final	Walker Fraser Steele	23/10/2022
Mortgage Certificate	Final	Walker Fraser Steele	23/10/2022
Property Questionnaire	Final	Mr. Stuart Glen	20/10/2022
EPC	File Uploaded	Walker Fraser Steele	23/10/2022

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is essential that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

PART 1

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Customer	Mr. Stuart Glen
Selling address	Flat 2/2 1322 London Road Glasgow G31 4LD
Date of Inspection	22/10/2022
Prepared by	Alan Hudson, MRICS Walker Fraser Steele

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

 \square

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

Page 6

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 <u>Category 3</u>: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 <u>Category 2</u>: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- ➤ *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a self-contained flat located on the second floor of a traditional four storey tenement block.
Accommodation	Entrance Hall, Living Room, Bedroom, Kitchen, Bathroom and Store Room.
Gross internal floor area (m2)	58 sq.m.
Neighbourhood and location	The subjects are located in the Parkhead area of Glasgow, approximately 3 miles to the East of the City centre. Residential properties in the area comprise a mix of styles and ages. There is a satisfactory range of residential amenities in the local area and there are good transport links connecting with the City Centre.
Age	The building is 128 years old.
Weather	At the time of our inspection, it was raining.
Chimney stacks	Visually inspected with the aid of binoculars where required.
	Visible chimney stacks are of stone construction with lead flashings.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where required. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this


	is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is of a traditional pitched design clad with concrete tiles.
	It has not been possible to inspect the rear roof slope due to the configuration of the site.
Rainwater fittings	Visually inspected with the aid of binoculars where required.
	Rainwater conductors are formed in a mix of cast-iron and plastic fittings
Main walls	Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.
	The outer walls are of sandstone construction roughcasted externally at the gable and rear elevation.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.
	Windows are formed with timber framed double glazed units.
	The entrance door to the property comprises a single leaf timber door unit.
External decorations	Visually inspected.
	Cast-iron and timber fittings are painted.
Conservatories / porches	Not applicable.
Communal areas	Circulation areas visually inspected.
	There is a communal close/stairwell providing access to all levels of the building and through to the back court area/
Garages and permanent outbuildings	Not applicable.
Outside areas and boundaries	Visually inspected.
Douituaries	There is a small back court area at the rear of the building.
-	

	1
	This area is generally paved and is bounded by metal railings.
Ceilings	Visually inspected from floor level.
	ceilings are formed with lath and plaster.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal partitions are of brick construction, plastered on hard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Floors are of suspended timber construction. Our inspection of floor surfaces has been restricted by the presence of floor coverings throughout.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.
	There is a range of doors, door facings and skirting boards throughout.
	The kitchen contains a range of wall mounted and base units.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out.
	The original fireplaces have been removed and closed, but the chimneybreasts remain intact.
Internal decorations	Visually inspected.
	Internal surfaces are papered and painted. Ceramic tiles and textured coatings have also been utilised.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will

	not turn them on.
	Mains supply.
	The electricity meter and consumer unit are located in the entrance hall.
Gas	There is currently no gas connection to the property. It appears that there may have been a gas supply in the past.
Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.
	Mains supply.
	Pipework, where visible is formed with copper and plastic fittings.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.
	There is a system of electric storage heaters. It should be noted that the bedroom has no heater.
	Hot water is provided by an electric immersion heating system. The hot water tank and immerser are located in a high level cupboard at the kitchen.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.
	Drains are assumed to be connected to the public sewage system.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. The new Fire and Smoke Alarm Standard came in to force in February 2022. This new standard requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner a carbon monoxide detector is also required. The purchaser should satisfy themselves in this

	regard. We note that smoke detectors have been installed. These have not been tested.
Any additional limits to inspection	Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the Surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the Surveyor is able to give an opinion on the general condition and standard of maintenance. At the time of our inspection, the property was unoccupied and unfurnished. However, floor coverings are in place throughout. The communal roof space has not been inspected as the means of access does not comply with standard surveying health and safety policies. Due to the configuration of the site, it has not been possible to inspect all of the roof surfaces.

Sectional Diagram showing elements of a typical house

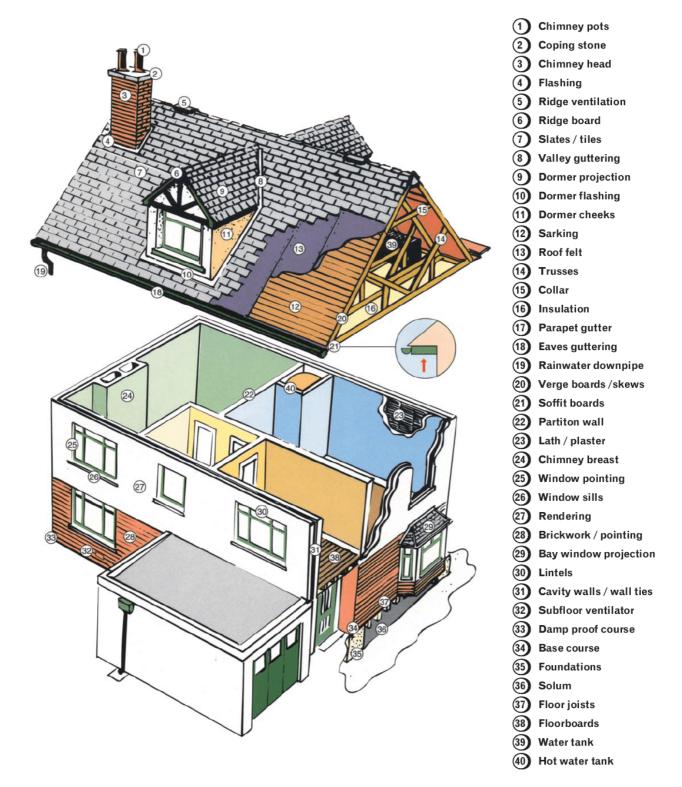

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement		
Repair category:	1	
Notes:	There are signs that the property has been affected by past structural movement as evidenced by cracks to the external masonry. So far as can be seen from this single inspection the movement appears to be long standing and does not appear to be progressive.	

Dampness, rot and infestation	
Repair category:	2
Notes:	Isolated readings of dampness at a level that would be sufficient to sustain fungal growth were obtained at the front elevation in the kitchen. Further investigation is warranted.

Chimney stacks	
Repair category:	2
Notes:	Chimneys are affected by excessive weathering and are likely to require some maintenance repairs in due course.

Roofing including roof space	
Repair category:	1

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	There are no obvious or significant defects noted to the parts of the
	roof that could be seen from ground level.

Rainwater fittings	3
Repair category:	3
Notes:	Gutters are choked by vegetation growth in places. From staining noted on the outer walls, it is apparent that the choked gutters are overflowing/spilling. As a result, it is likely that water ingress is taking place and entering the fabric of the building.

Main walls	
Repair category:	2
Notes:	Stonework is marked and excessively weathered. There are hairline cracks in places. This is consistent with the structural movement that is mentioned earlier.
	Areas of stonework are delaminating and spalling and some repairs are likely to be required in due course.
	The roughcast at the rear elevation is also affected by weathering.

Windows, external doors and joinery	
Repair category:	2
Notes:	Window frames are affected by excessive weathering and will require overhaul and repainting. Mastic pointing to some of the window openings is noted to be cracked and worn and should be replaced to prevent possible water ingress.

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

It appears that the edge seals to some of the window units have failed resulting in misting of the sealed units.

External decorations	
Repair category:	2
Notes:	Paintwork to timber components is quite badly weathered and will require overhaul.

Conservatories / porches	
Repair category:	
Notes:	Not applicable.

Communal areas	3
Repair category:	1
Notes:	The common close generally has a tidy appearance.

Garages and permanent outbuildings	
Repair category:	
Notes:	Not applicable.

Outside areas and boundaries

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	The communal garden area at the rear has been adequately maintained for the time of year.

Ceilings	
Repair category:	
Notes:	No obvious defects to report.

Internal walls	
Repair category:	
Notes:	No obvious issues to report.

Floors including sub-floors	
Repair category:	
Notes:	Floors are generally level, but some unevenness is noted in places. This is relatively normal in a building of this age and construction.

Internal joinery and kitchen fittings	
Repair category:	2
Notes:	Internal joinery fittings have been adequately maintained.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Kitchen fittings have a worn appearance.

Chimney breasts and fireplaces	
Repair category:	
Notes:	There are no obvious defects noted at the chimney breasts.

Internal decorations	
Repair category:	1
Notes:	Internal decorations have a relatively fresh appearance.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	1
Notes:	The electrical system has not been tested as this is outside our remit. There are no obvious issues to report, but we would point out that the Institute of Electrical Engineers advise that a domestic electrical installation should undergo a safety inspection every 5 years or at a change of ownership.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Gas	
Repair category:	
Notes:	No gas connection.

Water, plumbing and bathroom fittings	
Repair category:	2
Notes:	There are no obvious defects noted to be affecting visible plumbing apparatus.
	The bathroom suite is affected by wear and tear and we note that silicone seals around the bath have a worn appearance and are likely to require replacement in the near future.

Heating and hot water			
Repair category:			
Notes:	The individual room heaters have not been tested as this is outside the scope of our inspection. However, we note that the storage heaters are quite old and have a rather worn appearance.		
	There are no obvious defects noted to be affecting the hot water storage tank and immersion heating unit.		

Drainage	
Repair category:	
Notes:	There are no obvious defects noted in connection with the foul or

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

surface water drainage systems.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	1
Rainwater fittings	3
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories / porches	
Communal areas	1
Garages and permanent outbuildings	
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

<u>Unrestricted parking within 25 metres:</u> For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Second
2. Are there three steps or fewer to a main entrance door of the property?	[]YES [x]NO
3. Is there a lift to the main entrance door of the property?	[]YES [x]NO
4. Are all door openings greater than 750mm?	[]YES [x]NO
5. Is there a toilet on the same level as the living room and kitchen?	[x]YES []NO
6. Is there a toilet on the same level as a bedroom?	[x]YES []NO
7. Are all rooms on the same level with no internal steps or stairs?	[x]YES []NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	[x]YES []NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

The property is assumed to be held in 'Absolute Ownership' and to be unaffected by any onerous Title restrictions or burdens.

The road and footpaths bounding the property are assumed to have been adopted by the Local Authority.

Estimated re-instatement cost (£) for insurance purposes

215000

Two Hundred and Fifteen Thousand Pounds

Valuation (£) and market comments

67000

Sixty Seven Thousand Pounds

The valuation reflects the current condition of the property. Prevailing market conditions in the local area have also been considered.

Report author:	Alan Hudson, MRICS	
Company name:	Walker Fraser Steele	
Address:	Cadell House 27 Waterloo Street Glasgow G2 6BZ	
Signed:	Electronically Signed: 219081-4F15AAF1-27F8	
Date of report:	23/10/2022	

P A R T 2.

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report Property: Flat 2/2 Client: Mr. Stuart Glen 1322 London Road Tenure: Absolute Ownership Glasgow G31 4LD 22/10/2022 Date of Reference: ES-4941071 Inspection: This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation - Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor. 1.0 **LOCATION** The subjects are located in the Parkhead area of Glasgow, approximately 3 miles to the East of the City centre. Residential properties in the area comprise a mix of styles and ages. There is a satisfactory range of residential amenities in the local area and there are good transport links connecting with the City Centre. 2.0 **DESCRIPTION** 2.1 Age: The building is 128 years old The subjects comprise a self-contained flat located on the second floor of a traditional four storey tenement block. CONSTRUCTION 3.0 The outer walls are of sandstone construction roughcasted to the rear and gable elevations. The roof is pitched and clad with concrete tiles. 4.0 **ACCOMMODATION** Entrance Hall, Living Room, Bedroom, Kitchen, Bathroom and Store Room. 5.0 SERVICES (No tests have been applied to any of the services) Water: **Electricity:** Gas: N/A Drainage: Mains Mains Mains **Central Heating:** N/A **OUTBUILDINGS** 6.0

Garage:	Not applicable.						
Others:	: Not applicable.						
7.0	of any woodw The report cal defects, partic Where defects accurate estin purchase. Gel	GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.					
	fabric of the build epairs to window		some attention	in the foreseeable future inclu	ding clearing of	fchoked	
Internally the wall of the pro		en adequately n	maintained, but	there is some isolated evidenc	e of water ingre	ess at the front	
masonry toge		n flooring etc S	So far as can be	structural movement as eviden seen from this single inspection			
8.0	ESSENTIAL I	REPAIR WORK	((as a condition	n of any mortgage or, to preser	ve the condition	n of the	
None.							
8.1 Retention	n recommended	d:					
9.0	ROADS &FO	ROADS &FOOTPATHS					
The road and	footpaths bound	ding the propert	y are assumed	to have been adopted by the L	ocal Authority.		
10.0	BUILDINGS I	NSURANCE	215000	GROSS EXTERNAL FLOOR AREA	70 sq.m.	Square metres	
	should be insu property in its allowance has	ired against tota existing design been included been made for	al destruction or and materials. I for inflation duri	m for which the property and so in a re-instatement basis assun Furnishings and fittings have n ing the insurance period or dui in on professional fees. Furthe	ning reconstruct not been include ring re-construc	tion of the ed. No tion and no	
11.0	GENERAL RI	GENERAL REMARKS					
implications of	of these issues p	rior to making a	n offer to purch	the purchaser should satisfy thase. and to be unaffected by any or			
12.0	adverse plann necessary Loc investigation of matters to be asbestos in or beyond the so	ning proposals, of all Authority colors any contamin outwith the scolors or more of its cope of this insp	onerous burden nsents, which m lation on, under pe of this report s components o pection to test fo	ossession and that the propents, title restrictions or servitude hay have been required, have nor within the property has been all property built prior to the yr fittings. It is impossible to ide to a specialist to undertake a	rights. It is assout the rights of the right	umed that all d obtained. No consider such contain est. It is dvised that if	
12.1	Market Value condition (£):		67000	Sixty Seven Thousand Poun	ds		
	1						
12.2	Market Value completion o						

	works (£):					
12.3	12.3 Suitable security for normal mortgage purposes?		Yes			
12.4	Date of Valuation:		23/10/2022			
Signature: Electronically		Signed: 21908 ²	-4F15AAF1-27F8			
Surveyor:	Alan Hudson		MRICS		Date:	23/10/2022
Walker F	Walker Fraser Steele					
Office: Cadell House 27 Waterloo Street Glasgow G2 6BZ		Tel: 0141 221 0442 Fax: email: Amanda.mcsorley@esurv. asersteele.co.uk,instructio				

P A R T 3 .

ENERGY **REPORT**

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	Flat 2/2 1322 London Road Glasgow G31 4LD
Customer	Mr. Stuart Glen
Customer address	Flat 2/2 1322 London Road Glasgow G31 4LD
Prepared by	Alan Hudson, MRICS Walker Fraser Steele

Energy Performance Certificate (EPC)

Dwellings

Scotland

FLAT 2/2, 1322 LONDON ROAD, GLASGOW, G31 4LD

Dwelling type: Mid-floor flat
Date of assessment: 22 October 2022
Date of certificate: 23 October 2022

Total floor area: 58 m²

Primary Energy Indicator: 519 kWh/m²/year

Reference number: 8512-1620-4109-0542-4222 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: ECMK


Main heating and fuel: Electric storage heaters

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,957	See your recommendations
Over 3 years you could save*	£2,241	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

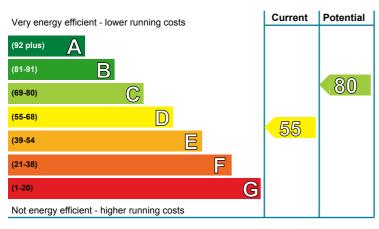


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (55)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

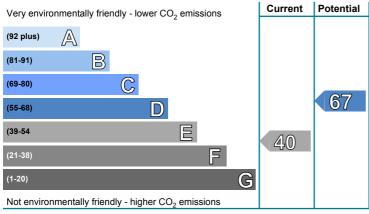

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (40)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£1521.00
2 Add additional 80 mm jacket to hot water cylinder	£15 - £30	£84.00
3 Low energy lighting	£10	£42.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
	Solid brick, as built, no insulation (assumed)	****	***
Roof	(another dwelling above)	_	_
Floor	(another dwelling below)	_	_
Windows	Fully double glazed	***	***
Main heating	Electric storage heaters	***	****
Main heating controls	Manual charge control	***	***
Secondary heating	Portable electric heaters (assumed)	_	_
Hot water	Electric immersion, off-peak	****	***
Lighting	Low energy lighting in 67% of fixed outlets	****	★★★★ ☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 88 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,688 over 3 years	£948 over 3 years	
Hot water	£1,029 over 3 years	£588 over 3 years	You could
Lighting	£240 over 3 years	£180 over 3 years	save £2,241
To	otals £3,957	£1,716	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Recommended measures		Indicative cost	Typical saving	Rating after improvement	
		Indicative cost	per year	Energy	Environment
1	Internal or external wall insulation	£4,000 - £14,000	£507	C 71	D 64
2	Add additional 80 mm jacket to hot water cylinder	£15 - £30	£28	C 72	D 65
3	Low energy lighting for all fixed outlets	£10	£14	C 73	D 65
4	High heat retention storage heaters and dual immersion cylinder	£800 - £1,200	£197	C 80	D 67

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

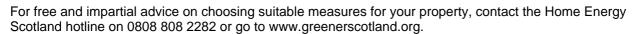



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

4 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	7,442	N/A	N/A	(4,210)
Water heating (kWh per year)	1,912			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK (www.ecmk.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Alan Hudson Assessor membership number: ECMK302881

Company name/trading name: Walker Fraser Steele

Address: 27

WATERLOO STREET

GLASGOW G2 6BZ

Phone number: 07801301462

Email address: alan.hudson@walkerfrasersteele.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



PART 4.

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address	Flat 2/2 1322 London Road Glasgow G31 4LD
Seller(s)	Stuart Glen
Completion date of property questionnaire	20/10/2022

Note for sellers

1.	Length of ownership	
	How long have you owned the proper 9 yrs 9 months	ty?
2.	Council tax	
	Which Council Tax band is your prop [x]A []B []C []D []E []F []G []H	erty in? (Please circle)
3.	Parking	
	What are the arrangements for parkin (Please tick all that apply)	g at your property?
	Garage	[]
	Allocated parking space	[]
	Driveway	[]
	Shared parking	[]
	On street	[x]
	Resident permit	
	Metered parking	
	Other (please specify):	

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[]YES [x]NO []Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[]YES [x]NO
6.	Alterations/additions/extensions	
а	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[]YES [x]NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[]YES[]NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[]YES [x]NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[]YES[]NO
	(ii) Did this work involve any changes to the window or door openings?	[]YES[]NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	
	Please give any guarantees which you received for this work to your solicitor or estate agent.	

7.	Central heating		
а	Is there a central heating system in your propartial central heating system is one which do the main rooms of the property - the main living bedroom(s), the hall and the bathroom).	oes not heat all	[]YES [x]NO []Partial
	If you have answered yes or partial - what kin heating is there? (Examples: gas-fired, solid storage heating, gas warm air).		
	If you have answered yes, please answer the below:	e three questions	
	(i) When was your central heating system or heating system installed?	partial central	
	(ii) Do you have a maintenance contract for the central heating system?		g []YES[]NO
	If you have answered yes, please give details with which you have a maintenance contract	• •	
	(iii) When was your maintenance agreement (Please provide the month and year).	last renewed?	
8.	Energy Performance Certificate		
	Does your property have an Energy Performation which is less than 10 years old?	ance Certificate	[x]YES []NO
9.	Issues that may have affected your prope	rty	
а	Has there been any storm, flood, fire or other damage to your property while you have own		[]YES [x]NO
	If you have answered yes, is the damage the outstanding insurance claim?	subject of any	[]YES[]NO
b	Are you aware of the existence of asbestos in	n your property?	[]YES [x]NO []Don't know
	If you have answered yes, please give details	s:	
10.	Services		
а	Please tick which services are connected to your property and give details of the supplier:		d give details of the

	Gas or liquid petroleum gas	N	
	Water mains or private water supply	N	
	Electricity	Υ	Scottish Power
	Mains drainage	N	
	Telephone	N	
	Cable TV or satellite	N	
	Broadband	N	
b	Is there a septic tank system at your property?		[]YES [x]NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the your septic tank?	discharge from	[]YES []NO []Don't know
	(ii) Do you have a maintenance contract for y	our septic tank?	[]YES[]NO
	If you have answered yes, please give detail with which you have a maintenance contract		
11.	Responsibilities for shared or common ar	eas	
а	Are you aware of any responsibility to contrib anything used jointly, such as the repair of a private road, boundary, or garden area? If you have answered yes, please give detail	shared drive,	[]YES [x]NO []Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		[x]YES []NO []N/A
	J.B.&G Forsyth property management services are the factors		3
С	Has there been any major repair or replacent the roof during the time you have owned the	• •	[]YES [x]NO
d	Do you have the right to walk over any of you property- for example to put out your rubbish your boundaries? If you have answered yes, please give detail	bin or to maintai	ר []YES [x]NO
е	As far as you are aware, do any of your neig right to walk over your property, for example rubbish bin or to maintain their boundaries? If you have answered yes, please give detail	to put out their	[]YES [x]NO

f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privatelyowned.) If you have answered yes, please give details:	[]YES [x]NO
12.	Charges associated with your property	
а	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[x]YES []NO
	J.B.&G. Forsyth property management services 213 West George Street, Glasgow G2 2LW Approx quarterly bill - £180	
b	Is there a common buildings insurance policy?	[x]YES []NO []Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	[x]YES []NO []Don't know
С	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
	N/A	
13.	Specialist works	
13.		[]YES [x]NO
	Specialist works As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your	[]YES [x]NO
	Specialist works As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they	[]YES [x]NO
а	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property. As far as you are aware, has any preventative work for dry rot,	
а	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	

property questionnaire

be shown in the original estimate. Guarantees are held by:

14.	Guarantees	
а	Are there any guarantees	or warranties for any of the following:
(i)	Electrical work	[]NO []YES [x]Don't know []With title deeds []Lost
(ii)	Roofing	[]NO []YES [x]Don't know []With title deeds []Lost
(iii)	Central heating	[]NO []YES [x]Don't know []With title deeds []Lost
(iv)	National House Building Council(NHBC)	[]NO []YES [x]Don't know []With title deeds []Lost
(v)	Damp course	[]NO []YES [x]Don't know []With title deeds []Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	[]NO []YES [x]Don't know []With title deeds []Lost
b	If you have answered 'yes installations to which the g	or 'with title deeds', please give details of the work or uarantee(s) relate(s):
С	Are there any outstanding claims under any of the guarantees listed above?	[]YES [x]NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	[]YES [x]NO []Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the	e past three years have you ever received a notice:	
111 (11)		

property questionnaire

b	that affects your property in some other way?	[]YES [x]NO
С	that requires you to do any maintenance, repairs or improvements to your property?	[]YES [x]NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.		
Signature(s):	Stuart Glen	
Capacity:	[x]Owner []Legally Appointed Agent for Owner	
Date:	20/10/2022	