

Single Survey

survey report on:

Property address	2 Viewfield Road, Fraserburgh, Aberdeenshire, AB43 9LN
-------------------------	---

Customer	Mrs D Cakebread
-----------------	-----------------

Customer address	13-21 High Street, Guildford, GU1 3DG
-------------------------	---

Prepared by	Harvey Donaldson And Gibson
--------------------	-----------------------------

Date of inspection	28th November 2022
---------------------------	--------------------



HARVEY
DONALDSON
& GIBSON
CHARTERED SURVEYORS
Parent to HomeReportScotland.scot

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

Terms and Conditions

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

Terms and Conditions

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	A semi detached two storey dwelling house.
Accommodation	The accommodation comprises: Ground floor - Entrance vestibule, hallway, dining room/bedroom, living room with kitchen off. First Floor - Landing, three bedrooms and bathroom with w.c.
Gross internal floor area (m²)	102
Neighbourhood and location	The subjects form part of an established Local Authority residential area lying to the west of Fraserburgh town centre, where surrounding properties are of similar age and character. A wide range range of facilities and amenities can be found within Fraserburgh.
Age	72 years.
Weather	Dry, sunny and cold.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimney is of pointed synthetic stone construction, sealed to the roof with metal flashings. The chimney pots are clay.
Roofing including roof space	The roof is pitched and covered with slates with a tiled ridge. Access to the roof space is via a hatch on the landing ceiling. The roof is made up of timber rafters and sarking boards.

Single Survey

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. Rainwater discharge is via cast iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The walls are of solid stone construction pointed externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Timber framed double glazed windows. The front and rear doors are timber with glazed panels. There are double glazed timber patio doors off the living room.
External decorations	Visually inspected. Painted external woodwork and metalwork.
Conservatories / porches	None.
Communal areas	None.
Garages and permanent outbuildings	Visually inspected. None
Outside areas and boundaries	Visually inspected. The property occupies a raised corner site with gardens to front, side and rear defined by a combination of stone and concrete block walls. Garden areas are laid to grass with a concrete slab area to rear.
Ceilings	Visually inspected from floor level. The ceilings appear plasterboard lined

Single Survey


Internal walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal walls are partly hard plastered on both faces. Some are timber framed and lined in plasterboard.</p>
Floors including sub floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The ground floor is a mixture of suspended timber construction and solid concrete construction. The first floor is of suspended timber construction.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors are moulded faced hollow core units. The skirting boards and door surrounds are timber. The staircase is timber.</p> <p>The kitchen fittings consist of floor and wall mounted units.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>Fireplaces throughout the property have been removed and sealed.</p>
Internal decorations	<p>Visually inspected.</p> <p>The ceilings are painted. The walls are papered and painted. The joinery is also painted.</p>
Cellars	<p>None.</p>

Single Survey

Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains electricity is installed. The meter and consumer unit are located in the cupboard under the stairs.</p> <p>The system appears to be of a 13 amp type and design. The switch and socket outlets are plastic and metal. The wiring is sheathed with PVC, where visible.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Gas is supplied from the mains. The meter is located in an external meter box.</p>
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Water is supplied from the mains.</p> <p>The bathroom contains a bath with electric shower overhead, wash hand basin and WC.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property is heated by a gas fired condensing boiler located in the cupboard under the stairs. The boiler is a combination boiler also providing hot water direct to taps.</p> <p>Heating to the rooms is provided by water filled radiators.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Mains drainage is understood to be connected.</p>

Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property has smoke detectors. There is a battery powered carbon monoxide alarm near the central heating boiler.</p> <p>Scottish government regulations came into effect on 1st February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Upgrading is required to comply with these regulations. Purchasers should satisfy themselves with regards to compliance.</p>
Any additional limits to inspection	<p>For flats / maisonettes</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>No access was gained to the sub floor.</p> <p>A limited inspection was possible of the roof void.</p> <p>No close inspection was possible to enclosed areas beneath and around washing appliances and sanitary fittings.</p> <p>An external inspection was carried out from ground level within the boundaries of the property and from adjoining highways.</p> <p>Areas of the property that were covered, unexposed or inaccessible have not been inspected. It cannot be confirmed that such areas are free from infestation, decay or other defects.</p> <p>The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>It should be appreciated that further defects can arise after the date of our inspection.</p>

Sectional Diagram showing elements of a typical house

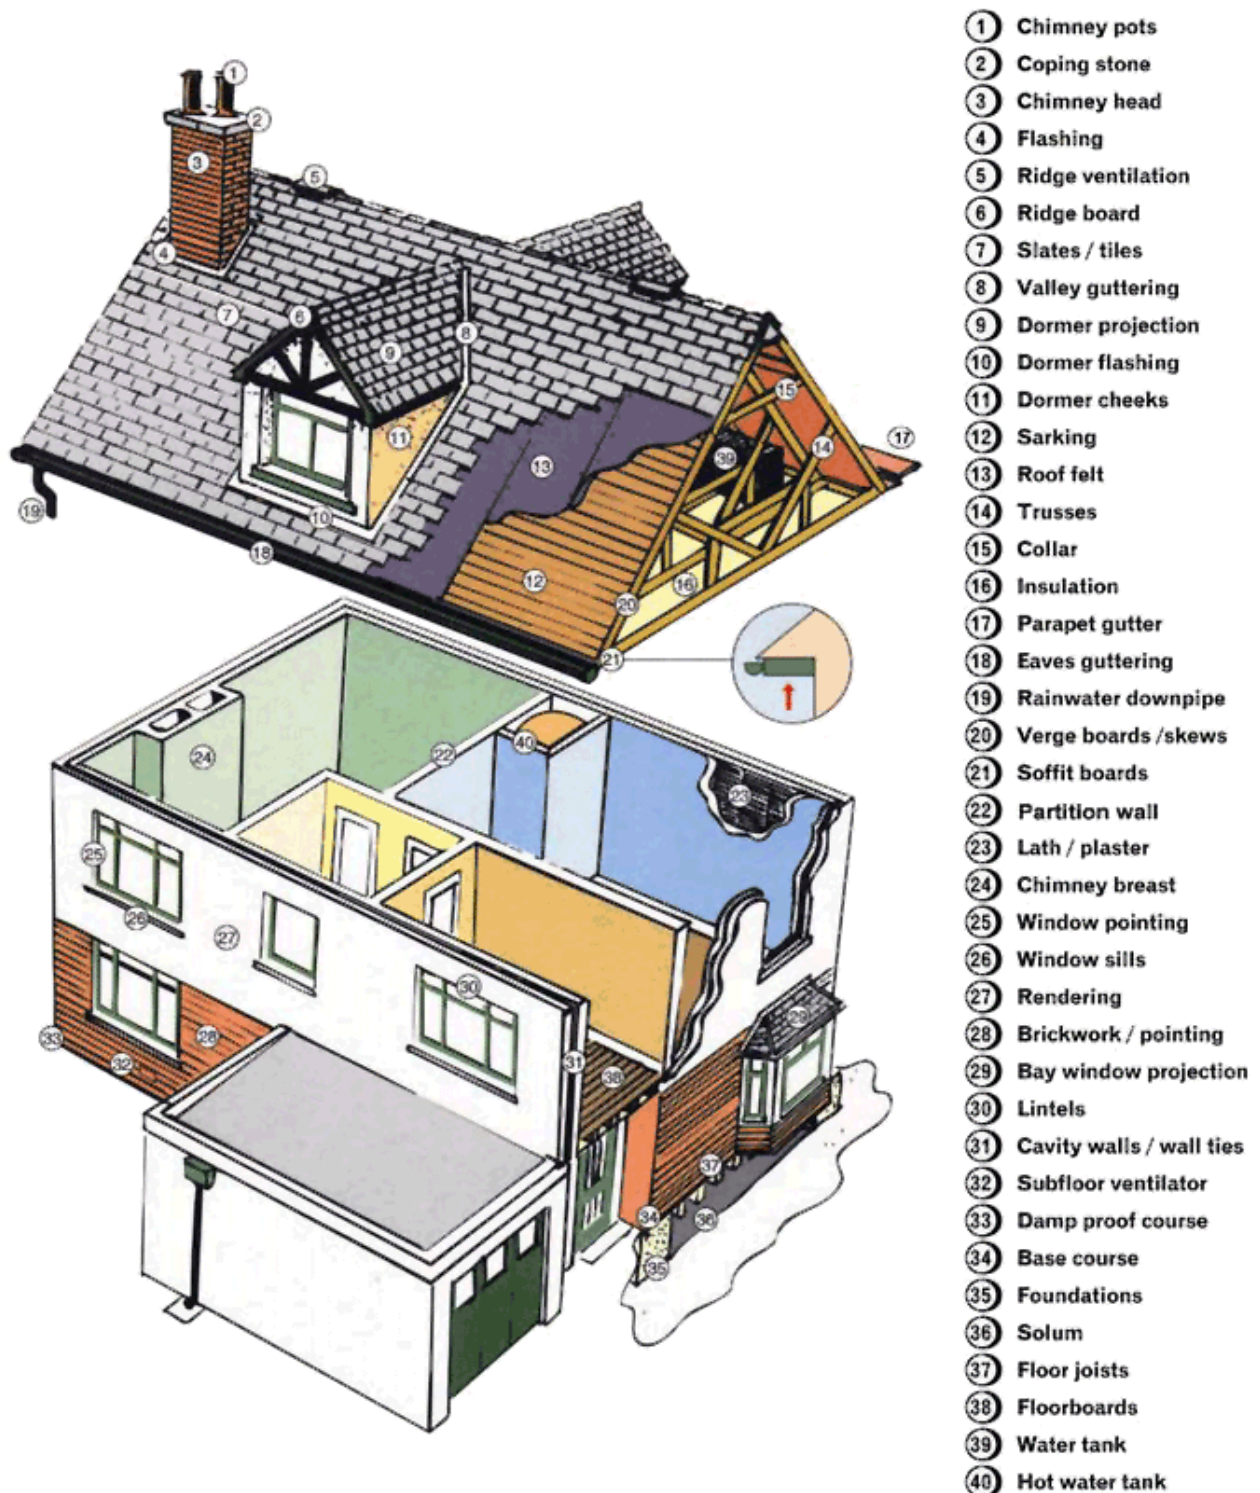


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	2
Notes	There is evidence of previous movement in the form of cracking to the external building fabric. The movement is considered to be longstanding in nature with no indication of recent structural deterioration. On the basis of a limited single inspection, no further significant movement is anticipated, although no assurances can be given as to the future.

 Dampness, rot and infestation	
Repair category	2
Notes	<p>A number of high isolated readings were noted at the date of our inspection. It is recommended that a reputable Timber / damp specialist firm be employed to carry out a detailed inspection of the entire subjects(Including exposure works) and thereafter implement all necessary remedial works under the cover of a long term guarantee. Our valuation assumes that extensive repairs are not required.</p> <p>Woodworm flight holes were noted, requiring timber specialist inspection with a view to eradication and issuing of long term transferable guarantee unless already treated.</p>

 Chimney stacks	
Repair category	2
Notes	<p>Open jointing was noted to the chimneyhead, which provides an entrance point for water ingress.</p> <p>There is a lean to one of the chimney pots.</p>



Roofing including roof space

Repair category	2
Notes	<p>Missing and damaged slates noted.</p> <p>Weathered and missing cement bedding noted to ridge tiles.</p> <p>Woodworm flight holes were noted to roof timbers(see Dampness, rot and infestation).</p> <p>For health reasons a full inspection of the roof space was not carried out due to the amount of bird droppings.</p> <p>It should be appreciated that a property of this age and type the roof structure and covering will require regular, ongoing maintenance.</p>



Rainwater fittings

Repair category	2
Notes	<p>Cast iron components show signs of corrosion.</p> <p>It will be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.</p>



Main walls

Repair category	2
Notes	<p>There is widespread cracking and open pointing to external walls (see Structural Movement). A programme of localised repointing should be carried out to prevent further deterioration.</p> <p>Cracking and spalling concrete sills and lintels due to corrosion of the steel reinforcement was noted. This is likely to be a progressive defect if not attended to.</p>



Windows, external doors and joinery

Repair category	2
Notes	<p>Some double glazed window units have failed, as a result of defective seals, allowing condensation to build between the panes.</p> <p>Damage was noted to doors and the seals around windows have perished in part whilst the patio doors have been sealed shut with silicone.</p> <p>Replacement of windows and doors should be considered.</p>



External decorations

Repair category	2
Notes	Cast iron components show signs of corrosion. There are flaking paint finishes to external decorations.



Conservatories/porches

Repair category	-
Notes	Not applicable.



Communal areas

Repair category	-
Notes	Not applicable.



Garages and permanent outbuildings

Repair category	2
Notes	The remains of timber sheds lie in the rear garden.



Outside areas and boundaries

Repair category	2
Notes	Cracking was noted to retaining boundary walls and other boundary walling. Garden areas are generally overgrown.



Ceilings

Repair category	2
Notes	There are areas of unevenness and minor cracking to ceiling surfaces.



Internal walls

Repair category	2
Notes	Plaster damage and cracking noted together with poor patch repairs.



Floors including sub-floors

Repair category	2
Notes	<p>No access to the sub floor was possible at the time of our visit. Within the limitations of our surface inspection there was no indication to suggest significant defects in this area. It will however be appreciated that this area was not inspected and therefore no guarantees can be provided in this regard.</p> <p>Damp staining was noted to a bedroom flooring next to the bathroom.</p> <p>Creaky and uneven areas noted.</p> <p>Considerable bird droppings were noted to the landing floor beneath the hatch to the roof space.</p> <p>Spillage often occurs to enclosed areas around sanitary fittings and washing appliances with consequent risk of deterioration or decay. The need for repairs can be revealed when coverings and fittings are removed.</p>



Internal joinery and kitchen fittings

Repair category	2
Notes	<p>Missing door ironmongery noted.</p> <p>Missing sections of skirting boards noted.</p> <p>Damaged kitchen units and doors noted.</p>



Chimney breasts and fireplaces

Repair category	1
Notes	It is generally regarded as good building practice to keep disused flues permanently vented to prevent condensation damage.



Internal decorations

Repair category	2
Notes	The internal decorations are marked in places from wear and tear.



Cellars

Repair category	-
Notes	Not applicable.



Electricity

Repair category	2
Notes	<p>It is likely that only the most recently re-wired properties will have electrical installations which fully comply with current regulations. The installation in this property appears relatively modern but there is no evidence of a recent test.</p> <p>It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.</p>



Gas

Repair category	2
Notes	<p>The gas supply was turned off. It appears that the meter has been removed.</p> <p>The gas installation should be inspected by a suitably qualified person prior to purchase.</p>



Water, plumbing and bathroom fittings

Repair category	2
Notes	<p>The system was drained down at the time of inspection.</p> <p>The sanitary fittings appeared generally satisfactory commensurate with type and age.</p> <p>It is important to maintain a watertight finish around the various fittings and appliances to prevent water spillage causing damage to surrounding surfaces and concealed areas. It is not possible to comment on the condition of concealed areas.</p>



Heating and hot water

Repair category	2
Notes	<p>The system was drained down at the time of inspection. The system should be fully checked over prior to recommissioning. A Gas Safe heating engineer can provide further advice.</p>

Single Survey



Drainage

Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	2
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	-
Electricity	2
Gas	2
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

The outright ownership details have not been checked by the surveyor, It is assumed that there are no unusually onerous provisions in the title documents.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialists advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The property has been altered with patio doors fitted off the living room. Confirmation should be obtained that the work was carried out with local authority approval.

The legal adviser should check confirm that the roads and sewers are adopted by the local authority.

It is assumed that there are no statutory, town planning, road or environmental matters which may have an adverse effect on the marketability or value of the property.

Estimated reinstatement cost for insurance purposes

£355,000 (Three hundred and fifty five thousand pounds).

Building costs are currently increasing significantly above inflation due to material and labour shortages. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.

Valuation and market comments

We are of the opinion that the market value of the property, in its present condition, and assuming full vacant possession on 28 November 2022 can be fairly stated in the sum of:

£70,000 (Seventy thousand pounds sterling).

Signed	Security Print Code [514125 = 7622]O Electronically signed
Report author	Keith Alexander
Company name	Harvey Donaldson And Gibson

Single Survey

Address	Rubislaw Den House, 23 Rubislaw Den North, Aberdeen, AB15 4AL
Date of report	29th November 2022

Mortgage Valuation Report



HARVEY
DONALDSON
& GIBSON
CHARTERED SURVEYORS
Parent to HomeReportScotland.scot

Property Address

Address 2 Viewfield Road, Fraserburgh, Aberdeenshire, AB43 9LN
Seller's Name Mrs D Cakebread
Date of Inspection 28th November 2022

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

No permanent outbuildings.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating:

Heating fuel: Gas
Heating type: Radiators

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

The subjects form part of an established Local Authority residential area lying to the west of Fraserburgh town centre, where surrounding properties are of similar age and character. A wide range of facilities and amenities can be found within Fraserburgh.

The subjects were found to be in a below average condition of repair. Whilst there are items in need of attention these are not considered essential and can be attended to during the course of routine maintenance.

There is evidence of previous movement in the form of cracking to the external building fabric. The movement is considered to be longstanding in nature with no indication of recent structural deterioration. On the basis of a limited single inspection, no further significant movement is anticipated, although no assurances can be given as to the future.

A number of high isolated readings were noted at the date of our inspection. It is recommended that a reputable Timber / damp specialist firm be employed to carry out a detailed inspection of the entire subjects(Including exposure works) and thereafter implement all necessary remedial works under the cover of a long term guarantee. Our valuation assumes that extensive repairs are not required.

Woodworm flight holes were noted, requiring timber specialist inspection with a view to eradication and issuing of long term transferable guarantee unless already treated.

The property has been altered with patio doors fitted off the living room. Confirmation should be obtained that the work was carried out with local authority approval.

The legal adviser should check confirm that the roads and sewers are adopted by the local authority.

It is assumed that there are no statutory, town planning, road or environmental matters which may have an adverse effect on the marketability or value of the property.

Essential Repairs

None noted.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property affords adequate security for loan purposes based on the valuation figure, subject to individual lender's criteria.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [514125 = 7622]O
Electronically signed by:-

Surveyor's name Keith Alexander

Professional qualifications AssocRICS

Company name Harvey Donaldson And Gibson

Address Rubislaw Den House, 23 Rubislaw Den North, Aberdeen, AB15 4AL

Telephone 01224418749

Fax 0203 880 9193

Report date 29th November 2022