HOME REPORT

FRONT COTTAGE THE SQUARE ACHNABA SQUARE

ACHNABA LOCHGILPHEAD





ENERGY PERFORMANCE CERTIFICATE



Energy Performance Certificate (EPC)

Dwellings

Scotland

FRONT COTTAGE THE SQUARE, ACHNABA SQUARE, ACHNABA, LOCHGILPHEAD, PA31 8RY

Dwelling type: Semi-detached house
Date of assessment: 03 October 2023
Date of certificate: 09 October 2023

Total floor area: 77 m²

Primary Energy Indicator: 773 kWh/m²/year

Reference number: 0774-1906-1200-5417-0200 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Electric storage heaters

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£12,630	See your recommendations
Over 3 years you could save*	£8,265	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

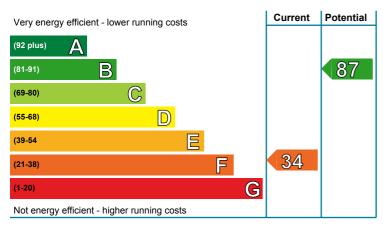


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (34)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

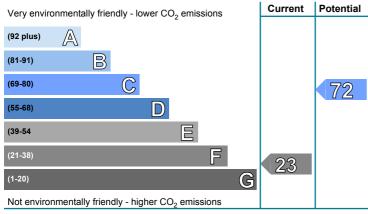

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (23)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£850 - £1,500	£558.00
2 Internal or external wall insulation	£4,000 - £14,000	£3096.00
3 Floor insulation (suspended floor)	£800 - £1,200	£1020.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Solid brick, as built, no insulation (assumed)	***	***
Roof	Pitched, 300 mm loft insulation Pitched, no insulation (assumed)	**** ***	**** ****
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	***	★★★☆☆
Main heating	Electric storage heaters Electric storage heaters	**** ***	★☆☆☆☆ ★☆☆☆☆
Main heating controls	Manual charge control	***	***
Secondary heating	Room heaters, electric	_	<u> </u>
Hot water	Electric immersion, off-peak	***	***
Lighting	Low energy lighting in 38% of fixed outlets	***	***

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 131 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 10 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 6.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£9,312 over 3 years	£3,303 over 3 years	
Hot water	£2,565 over 3 years	£597 over 3 years	You could
Lighting	£753 over 3 years	£465 over 3 years	save £8,265
Total	s £12,630	£4,365	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment
1	Flat roof or sloping ceiling insulation	£850 - £1,500	£186	F 36	F 25
2	Internal or external wall insulation	£4,000 - £14,000	£1032	E 53	E 41
3	Floor insulation (suspended floor)	£800 - £1,200	£340	D 58	E 46
4	Add additional 80 mm jacket to hot water cylinder	£15 - £30	£139	D 60	E 48
5	Low energy lighting for all fixed outlets	£25	£75	D 61	E 48
6	High heat retention storage heaters and dual immersion cylinder	£2,000 - £3,000	£777	C 71	E 53
7	Solar water heating	£4,000 - £6,000	£68	C 73	D 58
8	Replacement glazing units	£1,000 - £1,400	£140	C 76	D 62
9	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£669	B 87	C 72

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

5 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

6 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

FRONT COTTAGE THE SQUARE, ACHNABA SQUARE, ACHNABA, LOCHGILPHEAD, PA31 8RY 09 October 2023 RRN: 0774-1906-1200-5417-0200 Recommendations Report

7 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

8 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

9 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	16,447	N/A	N/A	(5,410)
Water heating (kWh per year)	2,491			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Gary Duff Assessor membership number: EES/009333

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: The Oban Times Building Corran Esplanade

Oban

PA34 5PX
Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



survey report on:

Property address	FRONT COTTAGE THE SQUARE ACHNABA SQUARE ACHNABA LOCHGILPHEAD PA31 8RY
Customer	M & K MacLeod Ltd
Customer address	Kilmory Industrial Estate Lochgilphead PA31 8RR
Prepared by	DM Hall LLP
Date of inspection	3rd October 2023



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	A semi-detached house.
Accommodation	GROUND FLOOR:- Hall, Living Room, One Bedroom and Kitchen. FIRST FLOOR:- Two Bedrooms and Bathroom.
Gross internal floor area (m²)	Approximately 77 square metres.
Neighbourhood and location	The property forms part of a scattered community to the east of Lochgilphead enjoying a degree of natural amenity. The property has partial views of Loch Fyne although some disturbance may be experienced from the adjacent A83 trunk road.
Age	Approximately 120 years.
Weather	Sunny with heavy showers continuing a mostly wet unsettled spell.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. There are three brick rendered and partly painted chimney heads
	with lead flashings.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space

	may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is pitched and clad with slates incorporating a flat lead platform, lead valleys and zinc ridges and hips.
	Access to the roof space is through a hatch over the landing. The hatch over the kitchen leads to a false ceiling only. The main roof is formed with timber rafters and incorporates tongued and grooved sarking. The roof space is partly full of storage and is insulated over the joists to various thickness. My inspection was therefore from the hatch only. There is a plastic cold water storage tank. The firewall appears to be of fibreboard type material. As the roof is hipped, there is no sight of the interior of the main walls.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The rainwater goods are plastic with gutters of half round design.
M-1	Viscollaria and Aurita de Latin and Aurita de
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls appear to be of solid brick construction rendered and painted externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	WINDOWS:- PVC sealed unit double glazed replacement windows of mixed age.
	DOORS:- The entrance doors are timber.
	JOINERY:- There are timber sills and timber and PVC roofline features.
External decorations	Visually inspected.
	Paint.
Conservatories / perchas	None
Conservatories / porches	None.

Communal areas None. Outside areas and permanent outbuildings None. Visually inspected. There is garden ground to the front and sides of the building. There garden is laid under mone blocks, stones and grass. The Title Deeds can be checked to confirm the exact extent of the garden ground and share thereof. Boundaries appear to be by the line of the shared access road and a stone wall at the A83. There are timber fences. Again the Title Deeds can confirm the exact position of the boundaries. Ceilings Visually inspected from floor level. The internal finishes are of plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard and plaster on the hard. Floors including sub floors Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There are integrated appliances including oven, hob and hood.		
Outside areas and boundaries Visually inspected. There is garden ground to the front and sides of the building. There garden is laid under mono blocks, stones and grass. The Title Deeds can be checked to confirm the exact extent of the garden ground and share thereof. Boundaries appear to be by the line of the shared access road and a stone wall at the A83. There are timber fences. Again the Title Deeds can confirm the exact position of the boundaries. Visually inspected from floor level. The internal finishes are of plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard and plaster on the hard. Floors including sub floors Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There	Communal areas	None.
There is garden ground to the front and sides of the building. There garden is laid under mono blocks, stones and grass. The Title Deeds can be checked to confirm the exact extent of the garden ground and share thereof. Boundaries appear to be by the line of the shared access road and a stone wall at the A83. There are timber fences. Again the Title Deeds can confirm the exact position of the boundaries. Visually inspected from floor level. The internal finishes are of plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard and plaster on the hard. Floors including sub floors Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There	Garages and permanent outbuildings	None.
There is garden ground to the front and sides of the building. There garden is laid under mono blocks, stones and grass. The Title Deeds can be checked to confirm the exact extent of the garden ground and share thereof. Boundaries appear to be by the line of the shared access road and a stone wall at the A83. There are timber fences. Again the Title Deeds can confirm the exact position of the boundaries. Visually inspected from floor level.		
garden is laid under mono blocks, stones and grass. The Title Deeds can be checked to confirm the exact extent of the garden ground and share thereof. Boundaries appear to be by the line of the shared access road and a stone wall at the A83. There are timber fences. Again the Title Deeds can confirm the exact position of the boundaries. Ceilings Visually inspected from floor level. The internal finishes are of plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard and plaster on the hard. Floors including sub floors Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There	Outside areas and boundaries	Visually inspected.
Internal walls Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard and plaster on the hard. Floors including sub floors Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		garden is laid under mono blocks, stones and grass. The Title Deeds can be checked to confirm the exact extent of the garden ground and share thereof. Boundaries appear to be by the line of the shared access road and a stone wall at the A83. There are timber fences. Again the Title Deeds can confirm the exact position
Internal walls Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard and plaster on the hard. Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There	Ceilings	Visually inspected from floor level.
Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard and plaster on the hard. Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		The internal finishes are of plasterboard.
Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard and plaster on the hard. Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		
Plasterboard and plaster on the hard. Plasterboard and plaster on the hard.	Internal walls	Visually inspected from floor level.
Floors including sub floors Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		
Carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		Plasterboard and plaster on the hard.
Carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		
a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Flooring is of timber construction. I was unable to locate any hatch to the sub-floor area. Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There	Floors including sub floors	
Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		a readily accessible and unfixed hatch by way of an inverted
Internal joinery and kitchen fittings Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		Flooring is of timber construction.
Moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		I was unable to locate any hatch to the sub-floor area.
Moved. Kitchen units were visually inspected excluding appliances. The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There		
The internal joinery timbers are of mixed age. The kitchen has older but replacement floor and wall units. There	Internal joinery and kitchen fittings	-
The kitchen has older but replacement floor and wall units. There		Kitchen units were visually inspected excluding appliances.
		The internal joinery timbers are of mixed age.
Chimney breasts and fireplaces Visually inspected.	Chimney breasts and fireplaces	
No testing of the flues or fittings was carried out.		No testing of the flues or fittings was carried out.
Former fireplaces have been removed and the flues have been blocked but not ventilated.		

Internal decorations	Visually inspected.
	Paint, paper and tile finishes.
	Tamis, paper and the inherice.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply. 13 amp plug sockets and plastic coated cabling where visible. The electricity meter is located over the kitchen door
Gas	at the rear. No mains gas available.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains water supply. The visible installation is in copper and plastic materials.
	The bathroom contains a white replacement three piece suite with an electric shower over the bath.
Heating and het water	Accessible parts of the system were visually inspected apart
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Electric heating and hot water appliances are provided. The hot water cylinder is located in the bathroom cupboard.
Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage is assumed to be to shared septic tank.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	Smoke detection provided.
	Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system

of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

Any additional limits to inspection

At the time of the inspection, the property was unoccupied and unfurnished and the bathroom and landing were covered. I was unable to locate any hatch to the sub-floor area.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

My physical inspection of the roof void area was restricted due to insulation material, stored items and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.

My inspection of the roof covering was restricted from ground level and some parts were not visible. Trees/surrounding buildings/site topography partially blocked sight lines. The flat roof coverings were not visible from ground level.

Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Floors coverings were not moved.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9 Dormer projection
- (10) Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- 13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 7) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- O Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- S
- 26) Window sills
- (27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 9) Water tank
- (40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category	2
Notes	There is evidence of dampness with a risk of rot and further investigation, including examination of concealed areas, should be carried out by an appropriate timber/damp specialist contractor, and repairs implemented to guaranteed standards. There is evidence of condensation in various locations. This may be alleviated by a proper balance of heating and ventilation. This should be monitored. Further advice can be obtained from a specialist contractor.

Chimney stacks	
Repair category	1
Notes	No significant defects evident.

Roofing including roof space	
Repair category	2
Notes	Broken and slipped slates were noted and corroded fixings were apparent. The flat section of roof and valley gutters can prove troublesome as any defect may allow spillage of water directly into the building fabric. Internally condensation was apparent.

Rainwater fittings	
Repair category	1
Notes	No significant defects evident.

Main walls	
Repair category	-
Notes	Areas of cracked and bossed rendering were apparent.

Windows, external doors and joinery	
Repair category	2
Notes	The seals to a number of the double glazed window units have failed resulting in condensation between the panes of glass. Missing fittings were noted internally. Some windows were noted to be stiff and lubrication or adjustment to the mechanisms would be beneficial.

External decorations	
Repair category	1
Notes	Weathered in places.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	1
Notes	Some loose stonework and damaged fencing noted at boundaries. Re-cultivation of some of the garden areas will be required.

Ceilings	
Repair category	1
Notes	No significant defects evident.

Internal walls	
Repair category	2
Notes	Affected by dampness in places. Some areas of uneven finish and wear and tear were noted.

Floors including sub-floors	
Repair category	2
Notes	Wind driven rain was noted along with water damaged flooring in places. Split and damaged timbers were apparent.

Internal joinery and kitchen fittings	
Repair category	2
Notes	The kitchen is likely to be upgraded by the purchaser to personal requirements. Some missing skirting boards were apparent. Wear and tear was noted.

Chimney breasts and fireplaces	
Repair category	2
Notes	Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented. Dampness was apparent.

Internal decorations	
Repair category	2
Notes	Staining was noted. Decoration is likely to be upgraded in accordance with personal taste.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	The electrical installation is of mixed age. Further advice will be available from a NICEIC/SELECT registered electrician. It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	-
Notes	Not applicable.

Water, plumbing and bathroom fittings				
Repair category	1			
Notes	The retention or replacement of the sanitary fittings will be a matter of personal taste.			

Heating and hot water			
Repair category	1		
Notes	No visible defects noted. It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.		

Drainage	
Repair category	1
Notes	No evidence of blockage or leakage apparent.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	-
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	-
Electricity	2
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt. These works do appear to be historic.

Estimated reinstatement cost for insurance purposes

£250,000 (TWO HUNDRED AND FIFTY THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments

£85,000 (EIGHTY FIVE THOUSAND POUNDS).

There is increasing hesitancy in some sectors of the property market due to increasing interest rates and changing economic circumstances/legislation.

Signed	Security Print Code [530846 = 9837]
	Electronically signed
Report author	Gary P Duff
Company name	DM Hall LLP
Address	The Oban Times Building, Corran Esplanade, Oban, Argyll, PA34 5PX
Date of report	20th October 2023

Mortgage Valuation Report



Property Address						
Address	FRONT COTTAGE THE SQUARE, ACHNABA SQUARE, ACHNABA, LOCHGILPHEAD, PA31 8RY					
Seller's Name M & K MacLeod Ltd Date of Inspection 3rd October 2023						
Property Details						
Property Type	X House Purpose built flat	Bungalow Converted flat	Purpose built maisonett Tenement flat	Converted maisonette Flat over non-residential use Other (specify in General Remarks)		
Property Style	Detached Back to back	X Semi detached High rise block	☐ Mid terrace ☐ Low rise block	☐ End terrace ☐ Other (specify in General Remarks)		
Does the surveyor be e.g. local authority, m		erty was built for	the public sector,	Yes X No		
Flats/Maisonettes only	y Floor(s) on which	located	No. of floors in block	Lift provided? Yes No		
Approximate Year of	Construction 1900		No. of units in block			
Tenure						
X Absolute Ownership	Leasehold	Ground rent £	Unexpired y	rears		
Accommodation						
Number of Rooms	1 Living room(s) 1 Bathroom(s)	3 Bedroom(s) 1 WC(s)	1 Kitchen(s) 0 Other (Specify in General	eral remarks)		
Gross Floor Area (exc			77 m² (Internal)	m² (External)		
Residential Element (greater than 40%)	X Yes No				
Garage / Parking / 0	Outbuildings					
Single garage Available on site?	Double garage X Yes No	X Parki	ng space	No garage / garage space / parking space		
Permanent outbuildings:						
None.						

Mortgage Valuation Report

Construction							
Walls	X Brick	Stone	Concrete	Timber frame	Other	r (specify in Gen	eral Remarks)
Roof	Tile	X Slate	Asphalt	Felt	Other	r (specify in Gen	eral Remarks)
Special Risks							
Has the property s	suffered struc	tural movemer	ıt?			Yes	X No
If Yes, is this rece	nt or progress	sive?				Yes	No
Is there evidence, immediate vicinity		ason to anticip	ate subsidence	, heave, landslip o	r flood in the	Yes Yes	X No
If Yes to any of the	e above, prov	ride details in G	Seneral Remark	S.			
Service Connec	tions						
Based on visual in of the supply in Go			es appear to be	non-mains, pleas	e comment (on the type a	nd location
Drainage	Mains	X Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	Mains	Private	X None
Central Heating	X Yes	Partial	None				
Brief description o	f Central Hea	ıting:					
Electric heating a	appliances pr	ovided.					
Site							
Apparent legal iss	ues to be ver	ified by the cor	nveyancer. Plea	ase provide a brief	description	in General R	emarks.
Rights of way	X Shared driv	res / access	Garage or other	amenities on separate	site Shar	ed service conn	ections
Ill-defined boundar	ies	Agricultu	ral land included wi	th property	Othe	er (specify in Ge	neral Remarks)
Location							
Residential suburb	Res	sidential within tow	n / city Mixe	d residential / commerc	cial Main	ly commercial	
Commuter village	Rei	mote village	Isola	ted rural property	X Othe	er (specify in Ger	neral Remarks)
Planning Issues	;						
Has the property been extended / converted / altered? X Yes No							
If Yes provide deta	ails in Genera	al Remarks.					
Roads							
X Made up road	Unmade roa	d Partly c	ompleted new road	Pedestrian ad	ccess only	Adopted	Unadopted

Mortgage Valuation Report

General Remarks
At the time of inspection, the property was unoccupied and unfurnished and some floors were covered. The condition of the property is fair only requiring various repairs, modernisation and upgrading works.
Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.
It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt. These works do appear to be historic.
The property has glimpse of Loch Fyne from a scattered rural community remaining conveniently located for all principal facilities available in nearby Lochgilphead.
Essential Repairs
None.
Estimated and of accordial agains C. Detection recommended 2. Detection recommended 3. Detection
Estimated cost of essential repairs £ Retention recommended? Yes X No Amount £

Mortgage Valuation Report

Comment on Mortgagea	bility	
The property forms suitable	le security for normal mortgage finance.	
Valuations		
Market value in present cor Market value on completion Insurance reinstatement va (to include the cost of total is a reinspection necessary	of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 85,000 £ N/A £ 250,000
Buy To Let Cases		
month Short Assured Tenai	ge of monthly rental income for the property assuming a letting on a 6 ncy basis? There there is a steady demand for rented accommodation of this type?	£ - Yes No
Declaration		
Signed Surveyor's name	Security Print Code [530846 = 9837] Electronically signed by:- Gary P Duff	
Professional qualifications	MRICS	
Company name	DM Hall LLP	
Address	The Oban Times Building, Corran Esplanade, Oban, Argyll, PA34 5PX	
Telephone	01631 564225	
Fax	01631 562373	
Report date	20th October 2023	

PROPERTY QUESTIONNAIRE





Property address	FRONT COTTAGE THE SQUARE ACHNABA SQUARE, ACHNABA, LOCHGILPHEAD, PA31 8RY
Seller(s)	M & K MACLEOD LIMITED
Completion date of property questionnaire	20.10.2023

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 40 YEARS
2.	Council tax
	Which Council Tax band is your property in? (Please circle)
	A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	Garage
	Allocated parking space
	Driveway
	Shared parking
	On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? Yes / No / Don't know desirable to preserve or enhance)?

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	Yes / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	Yes / Ne
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes / No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes / No
	(ii) Did this work involve any changes to the window or door openings?	Yes / No
	(iii) Please describe the changes made to the windows, doors or patio doors (windows when the work was completed):	vith approximate
	EXTERNAL DOORS REPLACED IN 1990s	
	Please give any guarantees which you received for this work to your solicitor or e	estate agent.

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	Yes / Ne / Partial
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	ELECTRIC STORAGE HEATERS & PANEL HEATERS	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	1990s
C.	Do you have a maintenance contract for the central heating system?	Yes / No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yos / No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yos / No
b.	Are you aware of the existence of asbestos in your property?	Yes / No
	If you have answered yes, please give details:	

10.	Service	2 S				
a.	Please tick which services are connected to your property and give details of the supplier:					
		Services	Connected	Supplier		
		Gas / liquid petroleum gas				
		Water mains / private water supply	✓	SCOTTISH WATER		
		Electricity	✓	SSE		
		Mains drainage				
		Telephone				
		Cable TV / satellite				
		Broadband				
b.		e a septic tank system at yo nave answered yes, please a		estions below:	Yes / No	
C.	(i) Do y	ou have appropriate conse	nts for the discha	rge from your septic tank?	Yes / No / Don't know	
d.	(ii) Do y	ou have a maintenance co	ntract for your se	otic tank?	Yes / No	
	If you I have a	nave answered yes, please maintenance contract:	give details of the	ne company with which you		

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yes / No / Don't Know
	If you have answered yes, please give details:	
	SHARED CAR PARKING - COVERED BY A DEED OF CONDITIONS	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Yes / No / Not applicable
	If you have answered yes, please give details:	
	COVERED BY A DEED OF CONDITIONS	
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes / No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Yes / No
	If you have answered yes, please give details:	
	COVERED BY A DEED OF CONDITIONS	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes / No
	If you have answered yes, please give details:	
	COVERED BY A DEED OF CONDITIONS	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	Yes / No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yos / No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

b.	Is there a common buildings insurance policy?	Yos / No /
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / No / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes / No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yos / No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for an	y of the	following	:			
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	No	¥es	Don't know	With title doods	Lost	Cannot Answor*
(iii)	Central heating	No	Yos	Den't know	With title doods	Lost	Cannot Answor*
(iv)	NHBC	No	Yos	Don't know	With title doods	Lost	Cannot Answor*
(v)	Damp course	No	¥es	Don't know	With title doods	Lost	Cannot Answor*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas te(s):	se give de	etails of t	he work		
c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:				¥es	/ No	
15.	Boundaries						
	So far as you are aware, has any boundary o last 10 years? If you have answered yes, please give details		operty be	een move	ed in the	Yes Don'	/ No / Lknow

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Den't know
b.	that affects your property in some other way?	Yes / No / Don't know
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Den't knew
	If you have answered yes to any of a-c above, please give the notices to your so agent, including any notices which arrive at any time before the date of entry of t your property.	olicitor or estate he purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
·			
Date:			



ABERDEEN

aberdeen_residential@dmhall.co.uk01224 594172

AYR

ayr@dmhall.co.uk 01292 286974

DUMFRIES

dumfries@dmhall.co.uk 01387 254318

DUNDEE

dundee@dmhall.co.uk 01382 873100

DUNFERMLINE

dunfermline@dmhall.co.uk 01383 621262

EDINBURGH

edinburghresidential@dmhall.co.uk 0131 624 6600

FLGIN

elgin@dmhall.co.uk 01343 548501

FALKIRK

falkirk@dmhall.co.uk 01324 628321

GALASHIELS

galashiels@dmhall.co.uk 01896 752009

GLASGOW (Residential)

glasgowresidential@dmhall.co.uk 0141 636 4141

HAMILTON

hamilton@dmhall.co.uk 01698 284939

INVERNESS

inverness@dmhall.co.uk 01463 241077

INVERURIE

inverurie@dmhall.co.uk 01467 624393

IRVINE

irvine@dmhall.co.uk 01294 311070

KIRKCALDY

kirkcaldy@dmhall.co.uk 01592 598200

LIVINGSTON

livingston@dmhall.co.uk 01506 490404

OBAN

oban-admin@dmhall. co.uk 01631 564225

PAISLEY

Enquiries are now dealt with at our Glasgow Hub.

PERTH

perth@dmhall.co.uk 01738 562100

PETERHEAD

peterhead@dmhall.co.uk 01779 470220

ST ANDREWS

standrews@dmhall.co.uk 01334 844826

STIRLING

stirling@dmhall.co.uk 01786 475785

