# **HOME REPORT**

#### **Townhouse Cairnbaan**

Lochgilphead PA31 8SQ



# ENERGY PERFORMANCE CERTIFICATE



### **Energy Performance Certificate (EPC)**

**Dwellings** 

# **Scotland**

#### Townhouse, Cairnbaan, Lochgilphead, PA31 8SQ

Dwelling type: Mid-terrace house
Date of assessment: 03 October 2023
Date of certificate: 09 October 2023

Total floor area: 153 m<sup>2</sup>

Primary Energy Indicator: 528 kWh/m²/year

Reference number: 9152-2967-3603-2707-4231
Type of assessment: RdSAP, existing dwelling

**Approved Organisation:** Elmhurst


Main heating and fuel: Electric storage heaters

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£16,068	See your recommendations
Over 3 years you could save*	£5,250	report for more information

<sup>\*</sup> based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

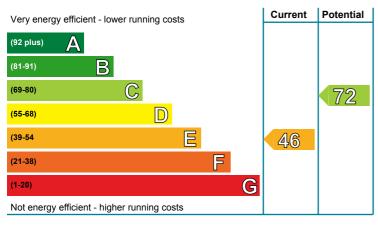


#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (46)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

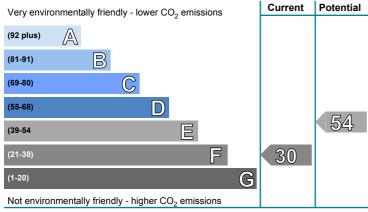

#### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide ( $CO_2$ ) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (30)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£850 - £1,500	£3075.00
2 Solar water heating	£4,000 - £6,000	£294.00
3 Double glazed windows	£3,300 - £6,500	£1884.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, partial insulation (assumed)	***	***
	Timber frame, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Flat, limited insulation (assumed)	***	$\bigstar$ $\updownarrow$ $\updownarrow$ $\updownarrow$ $\updownarrow$
	Flat, insulated (assumed)	<b>★★★☆☆</b>	$\star\star\star$
Floor	Suspended, insulated	_	_
	To external air, limited insulation (assumed)	_	_
Windows	Some double glazing	****	****
Main heating	Electric storage heaters	***	$\bigstar$ $\updownarrow$ $\updownarrow$ $\updownarrow$ $\updownarrow$
	Electric storage heaters	***	$\bigstar$ $\updownarrow$ $\updownarrow$ $\updownarrow$ $\updownarrow$
Main heating controls	Manual charge control	***	***
Secondary heating	Room heaters, electric	_	_
Hot water	Electric immersion, off-peak	***	***
Lighting	Low energy lighting in all fixed outlets	****	****

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

#### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 89 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 14 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 5.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£14,283 over 3 years	£9,357 over 3 years	
Hot water	£1,077 over 3 years	£741 over 3 years	You could
Lighting	£708 over 3 years	£720 over 3 years	save £5,250
Tota	ls £16,068	£10,818	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving	Rating after improvement	
		indicative cost	per year	Energy	Environment
1	Flat roof or sloping ceiling insulation	£850 - £1,500	£1025	D 57	E 39
2	Solar water heating	£4,000 - £6,000	£98	D 58	E 41
3	Replace single glazed windows with low- E double glazed windows	£3,300 - £6,500	£628	D 65	E 49
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£669	C 72	E 54

## Choosing the right improvement package





#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

#### 2 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### 3 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

#### 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	23,592	N/A	N/A	N/A
Water heating (kWh per year)	2,206			

#### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Gary Duff Assessor membership number: EES/009333

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: The Oban Times Building Corran Esplanade

Oban PA34 5PX

Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



# SINGLE SURVEY



## survey report on:

Property address	Townhouse Cairnbaan Lochgilphead PA31 8SQ
Customer	Christine Dobson
	Cairnbaan Hotel Cairnbaan PA31 8SQ
Prepared by	DM Hall LLP
Date of inspection	3rd October 2023



#### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report <sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

#### PART 2 - DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

#### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	A Mid Terraced House.
Accommodation	On Ground Floor: Hall, Two Bedrooms each with an Ensuite Bathroom and one Utility room.  On First Floor: Landing, and open plan Living Room/Dining room, Kitchen and Toilet with a Master Bedroom and Ensuite Shower Room to a rear outshoot.
Gross internal floor area (m²)	Approximately 153 m2.
Neighbourhood and location	The property is located adjacent to the Cairnbaan Hotel with attractive views over the Crinnan Canal, in an established generally residential area. The property is conveniently located for all available facilities in nearby Lochgilphead.
Age	Approximately 53 years.
Weather	Sunny with heavy showers continuing an unsettled spell.
Chimney stacks	None.
Roofing including roof space	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.  Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.  If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.  The roof is flat and clad with profile metal sheeting.

	There is no roof space.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The rainwater goods are plastic with half round design.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are of timber framed construction clad with timber externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows: Timber framed and aluminium single and double glazing including patio doors.
	External Doors: The entrance doors to front and rear are timber, single glazed. There are aluminium single and double glazed patio doors.
	Joinery: There are timber roof line features.
External decorations	Visually inspected.
	Paint or preservative stain finish.
Conservatories / porches	None.
Communal areas	None.
Garages and permanent outbuildings	None.
Outside areas and boundaries	Visually inspected.
	The garden ground around the building appears to be common. There is a timber deck at the rear and balconies at ground and first floors to the front.

Ceilings	Visually inspected from floor level.
	Plasterboard.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Flooring is of timber construction.
	Access to the sub floor area is through an external hatch to the brickwork at the front elevation. The solum was covered and the walls are of brick construction to floor joist level. The floors have been retrospectively insulated between the joists which limited the scope of my inspection.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal joinery timbers are of mixed age.
	The kitchen has older replacement floor units and wall shelves. There is a gas fired range style cooker.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There is a timber fireplace in the lounge, which has been blocked but not ventilated.
Internal decorations	Visually inspected.
	Paint, paper, proprietary sheet and tile finishes.

Cellars Visu acce	ally inspected where there was a safe and purpose-built ess.
The	cellar is described under section 'floors' above.
remosyst serv mee surv	essible parts of the wiring were visually inspected without oving fittings. No tests whatsoever were carried out to the em or appliances. Visual inspection does not assess any ices to make sure they work properly and efficiently and t modern standards. If any services are turned off, the reyor will state that in the report and will not turn them on.  It is supply. 13 amp plug sockets and plastic coated cabling re visible.
reme syst serv mee	essible parts of the system were visually inspected without oving fittings. No tests whatsoever were carried out to the em or appliances. Visual inspection does not assess any ices to make sure they work properly and efficiently and t modern standards. If any services are turned off, the reyor will state that in the report and will not turn them on.
Bottl	ed gas supply provided.
	al inspection of the accessible pipework, water tanks, nders and fittings without removing any insulation.
	ests whatsoever were carried out to the system or iances.
	ns water supply. The visible installation is in copper and plastic
mate	erials.
The an e	
The an e item	two ensuite bathrooms contain a white three piece suite with lectric shower. One of which was particularly full of stored
The an e item. The room  Heating and hot water  Acceptage  Accepta	two ensuite bathrooms contain a white three piece suite with lectric shower. One of which was particularly full of stored s and no access was possible.  toilet has a white two piece suite. The upstairs ensuite shower
The an e item The room  Heating and hot water  Acceptor  No t	two ensuite bathrooms contain a white three piece suite with lectric shower. One of which was particularly full of stored s and no access was possible.  toilet has a white two piece suite. The upstairs ensuite shower has a white three piece suite.
The an e item The room  Heating and hot water  Accefron No tapple	two ensuite bathrooms contain a white three piece suite with lectric shower. One of which was particularly full of stored and no access was possible.  It toilet has a white two piece suite. The upstairs ensuite shower in has a white three piece suite.  Sessible parts of the system were visually inspected apart in communal systems, which were not inspected.  Sests whatsoever were carried out to the system or
Heating and hot water  According No tappi	two ensuite bathrooms contain a white three piece suite with lectric shower. One of which was particularly full of stored and no access was possible.  toilet has a white two piece suite. The upstairs ensuite shower has a white three piece suite.  essible parts of the system were visually inspected apart a communal systems, which were not inspected.  ests whatsoever were carried out to the system or liances.  electric heating provided. Hot water is by electrical immersion
Heating and hot water  Heating and hot water  Acceptor  No tapple  Part to th  Drainage  Drai	two ensuite bathrooms contain a white three piece suite with lectric shower. One of which was particularly full of stored and no access was possible.  toilet has a white two piece suite. The upstairs ensuite shower has a white three piece suite.  essible parts of the system were visually inspected apart a communal systems, which were not inspected.  ests whatsoever were carried out to the system or liances.  electric heating provided. Hot water is by electrical immersion e hot water cylinder in the landing cupboard.

#### Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

None apparent.

Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

#### Any additional limits to inspection

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

My inspection of the roof covering was restricted from ground level and some parts were not visible. (Trees/surrounding buildings/site topography) partially blocked sight lines. The flat roof coverings were not visible from ground level.

Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

Services have been shut off or drained. Relevant trades should be on site when reintroducing services to identify and rectify all deficiencies.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice

should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

My inspection of the sub floor area was to the front of the building only and was restricted due to insulation provided between the floor joists.

There is no roof space.

#### Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4) Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- 13) Roof felt
- (14) Trusses
- (15) Collar
- (16) Insulation
- 7) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- O Verge boards /skews
- (21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- $\simeq$  .
- 25) Window pointing
- 26) Window sills
- (27) Rendering
- 28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category	3
Notes	Wind driven rain and water damaged flooring was noted. The solum was noted to be damp.
	Mouse poison was noted in the accommodation.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1
Notes	The flat roof coverings have a limited lifespan.

Rainwater fittings	
Repair category	1
Notes	No significant defects evident.

Main walls	
Repair category	2
Notes	Timber decay and vegetation growth noted to external walls. Vigilant maintenance will be required as defects to the external timbers can allow the ingress of moisture to the structural timber frame. The consequences of neglect can be serious.

Windows, external doors and joinery	
Repair category	3
Notes	Most prospective purchasers would upgrade to double glazing. There is a shattered glazed area at patio door. Missing handles were noted. The rear door was noted to be locked and warped.

External decorations	
Repair category	2
Notes	Weathered and peeling in places.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	3
Notes	Decayed and missing timbers were noted at decking and entrance steps. The balcony is noted to be off level in places. Corrosion was noted to railings and metal beams. Further off plumb timbers were noted at the balcony. The decking was noted to be particularly slippery.

Ceilings	
Repair category	2
Notes	Staining and plaster cracking noted.

Internal walls	
Repair category	2
Notes	Plaster damage and staining noted.

Floors including sub-floors	
3	
Wind driven rain and water damaged flooring noted. Creaky and off level sections were noted along with some uneven and loose boards.  The solum was noted to be damp.	
3 ^	

Internal joinery and kitchen fittings	
Repair category	2
Notes	Missing handles noted. The glazed door at the cooker was noted to be missing. The successful purchaser is likely to budget to upgrade the kitchen facility in accordance with personal requirements.

Chimney breasts and fireplaces	
Repair category	1
Notes	The fireplace is a feature only.

Internal decorations	
Repair category	2
Notes	Staining was noted. The incoming purchaser will upgrade in accordance with personal taste.

Cellars	
Repair category	2
Notes	Damp solum noted.

Electricity	
Repair category	2
Notes	Broken fittings and dated installation noted. Further advice can be obtained from a qualified, NICEIC/SELECT registered electrician.

Gas	
Repair category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Water, plumbing and bathroom fittings				
Repair category	2			
Notes	Dampness was noted adjacent to a bath. The seals will require to be checked and made watertight and the underlying area inspected for any further damage. It should be ensured that all seals around sanitary fittings are maintained in a watertight condition.			

Heating and hot water				
Repair category	1			
Notes	No visible defects noted.			

Drainage	
Repair category	1
Notes	No surface evidence of blockage or leakage apparent.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	3
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	3
Ceilings	2
Internal walls	2
Floors including sub-floors	3
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	2
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

#### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

#### Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	First floor		
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X		
3. Is there a lift to the main entrance door of the property?	Yes No X		
4. Are all door openings greater than 750mm?	Yes No X		
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No		
6. Is there a toilet on the same level as a bedroom?	Yes X No		
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X		
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No		

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

The property appears to have been extended around 1992. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The subjects form part of a terraced building and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of any common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

It should be confirmed if there is a Right of Access to the subject property. The Title Deeds should be checked to ensure appropriate Rights of Access exist and confirmation can be obtained that there is a car parking space is allocated to the subject property.

#### Estimated reinstatement cost for insurance purposes

£450,000 (FOUR HUNDRED AND FIFTY THOUSAND POUNDS)

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

#### Valuation and market comments

£185,000 (ONE HUNDRED AND EIGHTY FIVE THOUSAND POUNDS).

There is evidence of increasing uncertainty in some sectors of the housing market due to increasing interest rates and changing economic circumstances/legislations.

Signed	Security Print Code [538178 = 5966 ] Electronically signed					
Report author	Gary P Duff					
Company name	DM Hall LLP					
Address	The Oban Times Building, Corran Esplanade, Oban, Argyll, PA34 5PX					

Date of report	23rd November 2023
----------------	--------------------

# Mortgage Valuation Report



Property Address							
Address Seller's Name Date of Inspection	Townhouse Cairnbaan, Lochgilphead, PA31 8SQ Christine Dobson 3rd October 2023						
Property Details							
Property Type	X House       Bungalow       Purpose built maisonette       Converted maisonette         Purpose built flat       Converted flat       Tenement flat       Flat over non-residential use         Other (specify in General Remarks)						
Property Style	□ Detached       □ Semi detached       □ Mid terrace       □ End terrace         □ Back to back       □ High rise block       □ Low rise block       □ Other (specify in General Remarks)						
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No nilitary, police?						
Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No No. of units in block Approximate Year of Construction 1970							
Tenure							
X Absolute Ownership	Leasehold Ground rent £ Unexpired years						
Accommodation							
Number of Rooms	1 Living room(s) 3 Bedroom(s) 1 Kitchen(s) 3 Bathroom(s) 4 WC(s) 1 Other (Specify in General remarks)						
•	Gross Floor Area (excluding garages and outbuildings)  153 m² (Internal)  165 m² (External)  Residential Element (greater than 40%) X Yes No						
Garage / Parking /	Outbuildings						
Single garage Available on site? Permanent outbuilding	☐ Double garage ☐ No garage / garage space / parking space ☐ No garage / garag						
None.							

# Mortgage Valuation Report

Construction								
Walls	Brick	Stone	Concr	ete X Timber fr	ame	Other (specify in General Remar		
Roof	Tile	Slate	Aspha	lt Felt		X Other (specify in General Remarks		
Special Risks								
Has the property	suffered struc	tural movem	ent?				Yes	X No
If Yes, is this rece	ent or progres	sive?					Yes	No
Is there evidence, immediate vicinity	•	ason to antic	cipate subside	nce, heave, land	Islip or flo	od in the	Yes	X No
If Yes to any of th	e above, prov	vide details in	General Ren	narks.				
Service Connec	ctions							
Based on visual in of the supply in G			rices appear to	be non-mains,	please co	omment	on the type a	nd location
Drainage	Mains	X Private	None	Wa	ater X	Mains	Private	None
Electricity	X Mains	Private	None	Ga	s 🗌	Mains	X Private	None
Central Heating	Yes	X Partial	None					
Brief description of	of Central Hea	ating:						
Part electric hea	ting.							
Site								
Apparent legal iss	sues to be ve	rified by the c	onvevancer.	Please provide a	a brief de	scription	in General R	emarks.
X Rights of way	X Shared dri	•		ther amenities on se		<u>.</u>	red service conn	
Ill-defined boundar	ries	Agricu	Itural land include				er (specify in Ger	
Location								
Residential suburb	Re	sidential within t	own / city	Mixed residential / c	ommercial	Mair	nly commercial	
X Commuter village	Re	mote village		Isolated rural proper	ty	Othe	er (specify in Ger	neral Remarks)
Planning Issues	s							
Has the property been extended / converted / altered? X Yes No								
If Yes provide details in General Remarks.								
Roads								
X Made up road	Unmade roa	ad Partly	completed new	road Pedes	trian acces	s only	Adopted	Unadopted

### Mortgage Valuation Report

General Remarks
At the time of inspection the property was occupied, furnished and floors were covered. Some areas were totally full of stored items and my inspection was severely restricted.
The condition of the property is fair only requiring various repairs and maintenance works.
The other accommodation noted above is a Utility room.
This work appears to have been carried out around 1992. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.
Essential Repairs
None.
Estimated cost of essential repairs £ Retention recommended? \[ \text{Yes} \ \text{X} \ \text{No} \] Amount £

### Mortgage Valuation Report

Comment on Mortgagea	bility			
The property may form su	itable security for some lenders, depending on their individual criteria.			
Valuations				
Market value in present condition  Market value on completion of essential repairs  Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?				
Buy To Let Cases				
What is the reasonable rangementh Short Assured Tenai	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£		
	here there is a steady demand for rented accommodation of this type?	Yes No		
Declaration				
Signed Surveyor's name	Security Print Code [538178 = 5966 ] Electronically signed by:- Gary P Duff			
Professional qualifications	MRICS			
Company name	DM Hall LLP			
Address	The Oban Times Building, Corran Esplanade, Oban, Argyll, PA34 5PX			
Telephone	01631 564225			
Fax	01631 562373			
Report date	23rd November 2023			

# PROPERTY QUESTIONNAIRE





Property address	Townhouse, Cairnbaan, Lochgilphead, PA31 8SQ
Seller(s)	CHRISTINE AND DARREN DOBSON
Completion date of property questionnaire	23/11/2023

#### **Note for sellers**

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

#### Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 24 YEARS
2.	Council tax
	Which Council Tax band is your property in? (Please circle)
	A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	• Garage
	● Allocated parking space ✓
	• Driveway
	Shared parking
	On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?  Yes / No / Don't know

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<del>Yes</del> / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  If you have answered yes, please describe below the changes which you have made:	<del>Yes</del> / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.  If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	<del>Yes</del> / <del>Ne</del>
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?  If you have answered yes, please answer the three questions below:	<del>Yes</del> / No
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes</del> / <del>No</del>
	(ii) Did this work involve any changes to the window or door openings?	<del>Yes</del> / <del>No</del>
	(iii) Please describe the changes made to the windows, doors or patio doors (vidates when the work was completed):	vith approximate
	Please give any guarantees which you received for this work to your solicitor or e	estate agent.

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<del>Yes</del> / <del>Ne</del> / Partial
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	ELECTRIC STORAGE	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	PRIOR TO PURCHASE
C.	Do you have a maintenance contract for the central heating system?	<del>Yes</del> / No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / <del>No</del>
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<del>Yes</del> / No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<del>Yes</del> / <del>No</del>
b.	Are you aware of the existence of asbestos in your property?	<del>Yes</del> / No
	If you have answered yes, please give details:	

10.	Service	<b>2</b> S					
a.	Please tick which services are connected to your property and give details of the supplier:						
		Services	Connected	Supplier			
		Gas / liquid petroleum gas					
		Water mains / private water supply	✓	SCOTTISH WATER			
		Electricity	✓	BRITISH GAS			
		Mains drainage	_				
		Telephone	✓	ВТ			
		Cable TV / satellite					
		Broadband	✓	ВТ			
				1			
b.		e a septic tank system at yo nave answered yes, please a		estions below:	Yes / <del>No</del>		
C.	(i) Do y	ou have appropriate conse	nts for the discha	rge from your septic tank?	Yes / No / Don't know		
d.	(ii) Do y	ou have a maintenance co	ntract for your sep	otic tank?	<del>Yes</del> / No		
	If you have a	nave answered yes, please maintenance contract:	give details of the	ne company with which you			

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	<del>Yes</del> / No / <del>Don't Know</del>
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	<del>Yes</del> / No / <del>Not applicable</del>
	If you have answered yes, please give details:	
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<del>Yes</del> / No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Yes / Ne
	If you have answered yes, please give details:	
	Right of access to back door.	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	<del>Yes</del> / No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	<del>Yes</del> / No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	<del>Yes</del> / No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

b.	Is there a common buildings insurance policy?	<del>Yos</del> / No /
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / No / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<del>Yes</del> / No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<del>Yos</del> / No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for an	y of the	following	:			
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	No	¥es	Don't know	With title doods	Lost	Cannot Answor*
(iii)	Central heating	No	Yos	Den't know	With title doods	Lost	Cannot Answor*
(iv)	NHBC	No	Yos	Don't know	With title doods	Lost	Cannot Answor*
(v)	Damp course	No	¥es	Don't know	With title doods	Lest	Cannot Answor*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas te(s):	se give de	etails of t	he work		
c.	Are there any outstanding claims under any of the guarantees listed above?  If you have answered yes, please give details:				¥es	/ No	
15.	Boundaries						
	So far as you are aware, has any boundary o last 10 years?  If you have answered yes, please give details		operty be	een move	ed in the	<del>Yes</del> <del>Don'</del>	/ No / <del>Lknow</del>

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Den't know
b.	that affects your property in some other way?	<del>Yes</del> / No / <del>Don't know</del>
C.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yes</del> / No / <del>Den't knew</del>
	If you have answered yes to any of a-c above, please give the notices to your so agent, including any notices which arrive at any time before the date of entry of t your property.	olicitor or estate he purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
·			
Date:			



#### **ABERDEEN**

aberdeen\_residential@dmhall.co.uk01224 594172

#### **AYR**

ayr@dmhall.co.uk 01292 286974

#### **DUMFRIES**

dumfries@dmhall.co.uk 01387 254318

#### **DUNDEE**

dundee@dmhall.co.uk 01382 873100

#### **DUNFERMLINE**

dunfermline@dmhall.co.uk 01383 621262

#### **EDINBURGH**

edinburghresidential@dmhall.co.uk 0131 624 6600

#### **FLGIN**

elgin@dmhall.co.uk 01343 548501

#### **FALKIRK**

falkirk@dmhall.co.uk 01324 628321

#### **GALASHIELS**

galashiels@dmhall.co.uk 01896 752009

#### **GLASGOW** (Residential)

glasgowresidential@dmhall.co.uk 0141 636 4141

#### **HAMILTON**

hamilton@dmhall.co.uk 01698 284939

#### **INVERNESS**

inverness@dmhall.co.uk 01463 241077

#### **INVERURIE**

inverurie@dmhall.co.uk 01467 624393

#### **IRVINE**

irvine@dmhall.co.uk 01294 311070

#### **KIRKCALDY**

kirkcaldy@dmhall.co.uk 01592 598200

#### LIVINGSTON

livingston@dmhall.co.uk 01506 490404

#### **OBAN**

oban-admin@dmhall. co.uk 01631 564225

#### **PAISLEY**

Enquiries are now dealt with at our Glasgow Hub.

#### **PERTH**

perth@dmhall.co.uk 01738 562100

#### **PETERHEAD**

peterhead@dmhall.co.uk 01779 470220

#### **ST ANDREWS**

standrews@dmhall.co.uk 01334 844826

#### **STIRLING**

stirling@dmhall.co.uk 01786 475785

